 


INFORMATIONS SERVICE SERVICE INFORMATION SERVICE INFORMATIONEN SERVICE INFORMATION INFORMACIONES SERVICIO INFORMACIONI SERVICIO SERVICE INFORMASJONER SERVICE INFORMATION INFORMAÇÃO SERVIÇO 7E

SEPTEMBER 1985 ENGLISH EDITION

1985 GRAND WAGONEER WITH 4.2L 6-CYL.



ENGINES

Attention: Workshop, Parts Department

HEATER CORE COOLANT HOSES

The heater core coolant hoses on some 1985 Grand Wagoneer vehicles equipped with 4.2L 6-Cyl. engines may contact the heater core housing in the engine compartment.


Reroute the hoses as described in the following procedure.

PROCEDURE

- Inspect the routings of the heater core coolant hoses at the heater core housing (3) of the engine compartment.
- If the heater core coolant hoses are not contacting the heater core housing return vehicle to stock/owner. If either heater core coolant hose is contacting the heater core housing, proceed to Step 3.
- Loosen the heater core coolant hose clamps

 (4) at the heater core. Rotate the hoses counter-clockwise to reposition the hoses away from the edge (3) of the heater core housing.
- 4. Retighten the heater core coolant hose clamps.

5. Tie both of the heater core coolant hoses (1, 2) together using a tie strap (5), P/N 322 3227, or equivalent.

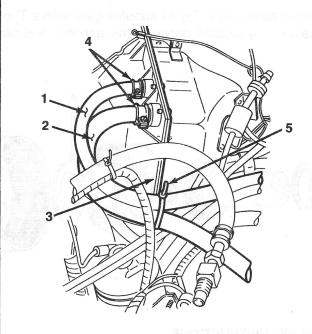

- 6. Start the engine and let it warm to operating temperature.
- 7. Check the heater core coolant hose system for coolant leaks.

PARTS INFORMATION

DESCRIPTION	QUANTITY	PART NUMBER	
STRAP, Nylon Tie	1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	322 3227	

SRT INFORMATION

OPERATION DESCRIPTION	NUMBER	TIME	TIC
HOSE, HEATER CORE - INSPECT AND/ OR REROUTE	0602	0.2	6-122

FILING INFORMATION

Record this procedure on page L-8 and file this I.S. Note in the M.R. 253 manual.