


I.S.

INFORMATIONS SERVICE
SERVICE INFORMATION
SERVICE INFORMATIONEN
SERVICE INFORMATION
INFORMACIONES SERVICIO
INFORMAZIONI SERVIZIO
SERVICEINFORMASJONER
SERVICE INFORMATIE
SERVICEINFORMATION
INFORMAÇÃO SERVIÇO

11E

APRIL, 1987
ENGLISH EDITION

1986-1987
GRAND WAGONEER/
TRUCK

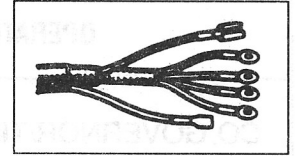

ELECTRICAL

ATTENTION: Workshop, Parts Department

INTERMITTENT WINDSHIELD WIPERS


Some 1986 and 1987 Grand Wagoneer/Truck vehicles built before VIN 1JXXXXXXXHTO87763 may have inconsistent intermittent wiper operation.

During high alternator output, such as after starting a cold engine, the intermittent operation of the windshield wipers may become erratic. The timed wiper sweep interval may gradually decrease until there is no pause between sweeps.

Service correction involves replacing the intermittent wiper governor.

PROCEDURE

1. Locate the intermittent wiper governor (A) under the left side of the instrument panel. Disconnect the connectors on each end of the governor and remove it.
2. Install the two connectors on a new intermittent wiper governor, PN 8956 002 692.
3. Install the new governor under the left side of the instrument panel.

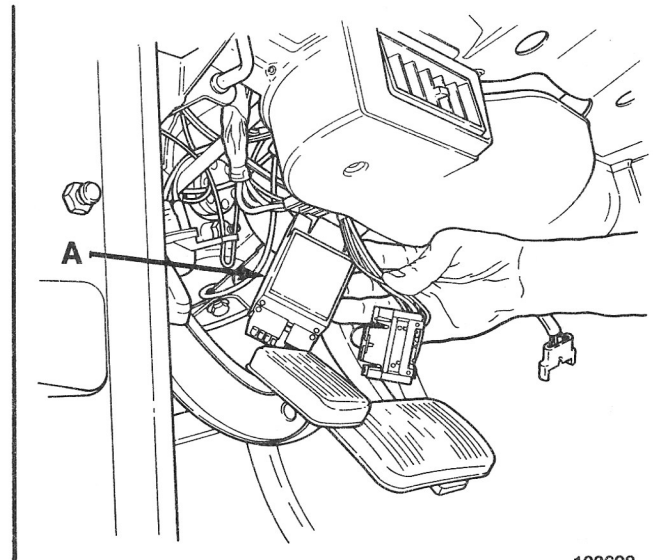

103698

PARTS INFORMATION

DESCRIPTION	QUANTITY	PART NUMBER
GOVERNOR, Intermittent Wiper	1	8956 002 692

SRT/TIC INFORMATION

OPERATION DESCRIPTION	OPERATION NUMBER	TIME	TIC	SUPPLIER CODE
CO. GOVERNOR/TIMER, WIPER- REPLACE	8748	0.3	8-533	556

FILING INSTRUCTIONS

Record this I.S. Note on page C-179 of M.R. 253 and file it in the manual.