





# TECHNICAL BULLETINS/DRBs 77-82

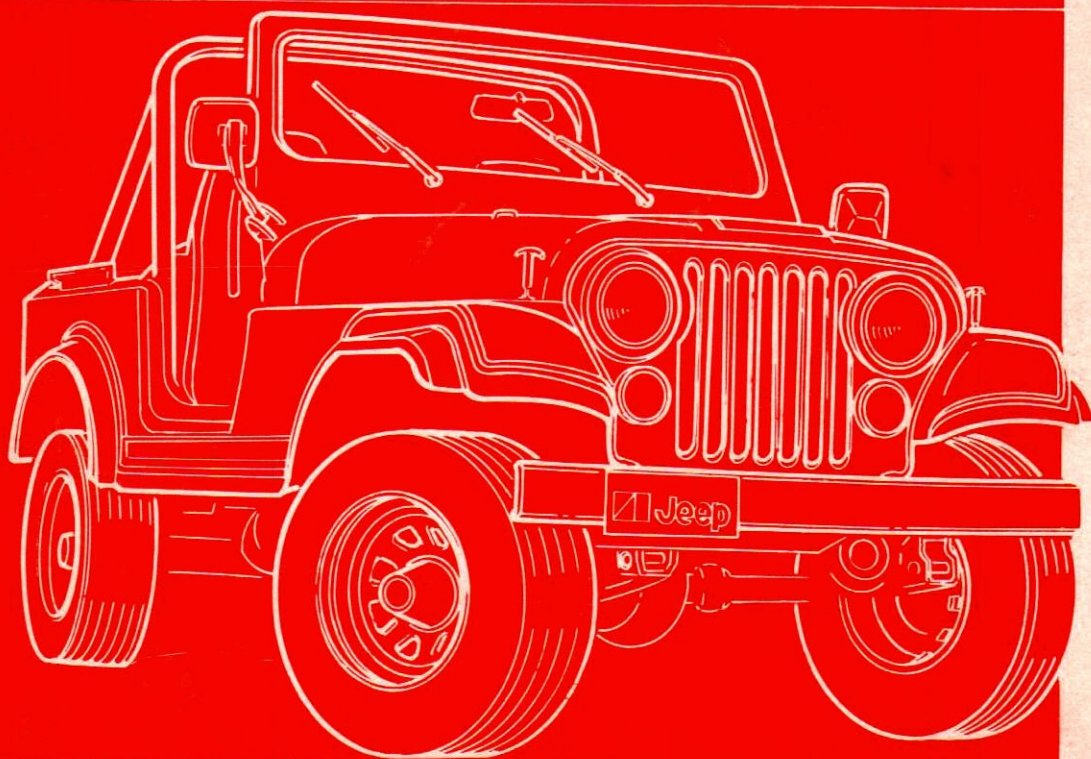

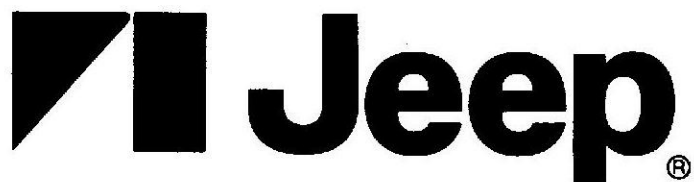

# Technical Bulletin Manual

---

**Diagnosis and Repair Bulletins**

---

**1977-82**

---

**MARCH 1984**

**U.S.A./CANADA EDITION**

**8981 320 465**

*Recd 5-23-84*

All information and specifications in this manual are based on the latest data available at the time of publication. American Motors Corporation reserves the right to discontinue designs or change specifications without notice or incurring obligation.

Copyright © 1984, American Motors Sales Corporation. All Rights Reserved.  
Litho in U.S.A.

# DIAGNOSIS AND REPAIR BULLETIN INDEX

## 1982 ENGINES-FUEL SYSTEMS-ENGINE ELECTRICAL-COOLING

Subject (Problem and Application)	Bulletin Number	Page
An Inoperative Cruise Command Servo on 1981-82 Jeep Vehicles may be due to a Cracked or Broken Manifold Vacuum Hose on the Servo.	1-13-82	82-1
Service Procedures and S.R.T. Times for the New Separate Coolant Temperature and Intake Manifold Heater (EFE) Control Switches and Wire Harness Adapter on 1982, Six-Cylinder Jeep Models, With Fuel Feedback System Built After February 18, 1982.	1-12-82	82-3
The Front Housing of Some 70 and 80 Amp Alternators on 1981-82 Wagoneer, Cherokee, and Truck Models With Eight-Cylinder Engine and Air Conditioning may Crack at the Upper Mounting Boss and Cause a Vibration.	1-11-82	82-5
The Pushrods in Some 1981-82 Jeep 258 CID Six-Cylinder Engines Built Prior to May 1982, may Disengage From the Rocker Arms Causing Noise, Backfire, or a Miss.	1-10-82	82-8
Normal Exhaust Pulses may Cause the Front Exhaust Pipe Support and Mounting Bolt to Vibrate and Produce a Rattling Noise on Some 1982 Wagoneer, Cherokee, and Truck Models With Six-Cylinder Engine and Automatic Transmission.	1-09-82	82-9
Improving Performance of 1982 Jeep Vehicles Being Operated at Altitudes Above or Below that which the Engine was Originally Certified for and Adjusted to.	1-08-82	82-11
The Cylinder Head Cover Removal/Installation Procedures Published in the 1982 Jeep Technical Service Manual for Six-Cylinder Engines are Incorrect.	1-06-82	82-13
The Exhaust Manifold to Front Exhaust Pipe Stud Nuts on 1982 Jeep Four-Cylinder Engines Built Prior to February 1982, may Loosen Causing an Exhaust Noise.	1-07-82	82-18
Unnecessary Replacement of Electronic Regulator used with 1981-82 Jeep Cruise Command Systems.	1-04-82	82-19
The Four-Cylinder Engine Identification Code Information in the 1982 Jeep Technical Service Manual and 1982 Jeep Service Specifications Handbook is Incorrect.	1-05-82	82-21
The Cruise Command Electronic Regulator may not be Properly Fastened on Some 1982 Wagoneer, Cherokee, and Truck Models.	1-03-82	82-22

## 1982 ENGINES-FUEL SYSTEMS-ENGINE ELECTRICAL-COOLING

Subject (Problem and Application)	Bulletin Number	Page
The Procedure for Replacing the Distributor Vacuum Advance Mechanism on 1982 Four-Cylinder CJ Models is Incomplete. The Procedure does not Indicate that the Distributor Must be Removed in Order to Replace the Vacuum Advance Mechanism.	1-02-82	82-24
The Cylinder Head-To-Block and Damper Pulley Hub Bolt Torques for 1982 Four-Cylinder Engines have been Changed.	1-01-82	82-25

## 1982 TRANSMISSION-TRANSFER CASE-CLUTCH-DRIVE SHAFTS

Subject (Problem and Application)	Bulletin Number	Page
GEARLUBE (Type "S" Campaign): Original Lubricant Used in T4 and T5 Transmissions to be Replaced With a New EP Type Lubricant.	2-10-82	82-26
Some 1982-83 Wagoneer and Cherokee models with a 360 CID Eight-Cylinder Engine and Automatic Transmission may Develop a Shudder-Type Vibration That Occurs When the Torque Converter Lockup Clutch Engages. The Condition is Often Compared to Driving Over Toll Booth Speed Warning Bumps and Occurs After the Third Gear Upshift and When Road Speed is Approximately 40 mph.	2-09-82	82-28

## 1982 TRANSMISSION-TRANSFER CASE-CLUTCH-DRIVE SHAFTS (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
This Bulletin Supersedes The Manual Transmission and Transfer Case Lubricant Specifications Published in Jeep Technical Bulletin Numbers 2-01-82 and 2-06-82 And in the 1982 Jeep Technical Service Manual and Service Specifications Handbook.	2-08-82	82-32
Some Model 208 Transfer Cases Built Prior to April 5, 1982, may Develop an Intermittent Clunk Noise that Only Occurs in 4-Wheel Drive High or Low Range and Primarily When Driving on Pavement.	2-07-82	82-34
Improper Servicing of the Reverse Gear Shift Rail on 1981-82 Jeep T-176 Manual Transmissions Built After June 29, 1981 Beginning with Serial Number RGFB-2695.	2-04-82	82-36
Difficulty Shifting into and out of Four Wheel Drive on some 1980-82 CJ and Scrambler Models with Model 300 Transfer Case.	2-05-82	82-37
The Clutch Plate Clearance Specification for Model 727 Automatic Transmissions with 4 Disc Front Clutches, is Incorrect in the 1980-81-82 Jeep Technical Service Manuals and 1980-81-82 Jeep Service Specifications Handbooks.	2-03-82	82-39
Transfer Case Shift Lever Rattles or makes a buzzing noise in Some 1980-82 CJ and Scrambler Models.	3-04-82	82-40
Model 208 and 219 Transfer Cases are Being Unnecessarily Disassembled When Only the Input Gear Oil Seal is Replaced.	2-02-82	82-42

## 1982 AXLES-SUSPENSION-BRAKES-STEERING

Subject (Problem and Application)	Bulletin Number	Page
Occasional Suspension Spring Squeaks and a Hard or Stiff Ride on a 1982 CJ Limited Model may be Caused by Improperly Installed Suspension Spring Retainers.	3-03-82	82-44
Disc Brake Caliper Pistons in Some 1976-82 Jeep Vehicles may Develop a Light coating of Rust on the Surface Under the Dust Seal Outboard of the Piston Seal.	3-02-82	82-45
Service Procedures and SSO Times for Air Adjustable Shock Absorbers on 1982 Jeep Wagoneer, Cherokee, and J-10 Truck Models.	3-01-82	82-47

## 1982 WINDSHIELD-WINDOWS-BODY HARDWARE

Subject (Problem and Application)	Bulletin Number	Page
Revisions Made to Certain Parts Have Improved the Operation of the Lock Button and Latch on CJ Models with Metal Doors and Remote Door Handles.	5-03-82	82-50
Discoloration or Peeling of the Finish Coat on Wood Side Rails Installed on Some 1981-82 Scrambler and Sportside Truck Models.	5-02-82	82-53
Power Windows on Some 1980-82 Wagoneer, Cherokee, and Truck Models may make a Scraping, Clicking Sound when Operated or may not Open Completely.	5-01-82	82-54

## 1982 BODY/CHASSIS ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
Oil Pressure Gauge Needle Flutters During Engine Operation on Some 1979-82 CJ and Scrambler Models.	8-05-82	82-58
The Trailer Tow Harness Wires may be Improperly Connected to the Receptacle on 1982 Wagoneer and Cherokee Models Equipped with a Class III Trailer Tow Package and Built Prior to May 3, 1982.	8-04-82	82-57
The Center Horn Button Cap on Some 1981-82 Jeep Vehicles with a Sport Steering Wheel may Rattle when Driving Over Bumps.	8-03-82	82-59

## 1982 BODY/CHASSIS ELECTRICAL (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Incorrect Radio Speakers may have been Installed in 1982 Wagoneer, Cherokee, and Truck Models with the Optional Electronically Tuned Cassette Stereo Radio (ETR).	8-02-82	82-61
The Cherokee, Wagoneer, and Truck Windshield Wiper Linkage Removal/Installation Procedures in the 1981-82 Jeep Technical Service Manual are Incorrect.	8-01-82	82-63

## 1982 PAINT-CORROSION PROTECTION-DECALS-MISC.

Subject (Problem and Application)	Bulletin Number	Page
Paint Codes and Intermix Formulas for 1983 Jeep Vehicles.	9-04-82	82-65
Hardtop Inner Panel (Headliner) Touches Hardtop Outer Panel on Some 1981-82 Scrambler Models Causing a Buzz or Flutter Noise.	9-03-82	82-70
The Odometer on Some 1981-82 Wagoneer, Cherokee, and Truck Models may Generate a High-Pitched Squeaking Noise that Occurs Only Occasionally and at any Speed.	9-02-82	82-72
1982 Jeep Paint Color Names and Code Numbers — Dupont.	9-01-82	82-74

## 1981 ENGINES

Subject (Problem and Application)	Bulletin Number	Page
An Inoperative Cruise Command Servo on 1981-82 Jeep Vehicles may be due to a cracked or broken Manifold Vacuum Hose on the Servo.	1-13-82	82-1
The Pushrods in some 1981-82 Jeep 258 CID Six-Cylinder Engines built prior to May 1982, may disengage from the Rocker Arms causing noise, backfire, or a miss.	1-10-82	81-1
Engine Knock may Recur on Some 1981 Jeep Four-Cylinder Engines even after Carbon Build-Up has been Removed with Jeep Carburetor and Combustion Area Cleaner.	81-4	81-2
Six-Cylinder Engine Cylinder Head Cover — 1981 Jeep Vehicles with Six-Cylinder Engine.	81-3	81-3
Carbon Knock — 1980-81 Jeep Vehicles With Four-, Six- or Eight-Cylinder Engine.	81-2	81-5
Engine Noise Diagnosis — 1981 Jeep CJ Models With Four-Cylinder Engine.	81-1	81-6
Oil Pump Release (Relief) Valve Plunger — Six-Cylinder Oil Pump — Revision to Service Technical Letter 81-15 Dated May 19, 1981 — Service Technical Letter — Refer to Service General.	81-17	81-72
Oil Pump Release Valve Plunger — 1981 Six-Cylinder Engine — Service Technical Letter — Refer to Service General.	81-15	81-74
Revision to 1981 Six-Cylinder PCV Valve Specifications — Service Technical Letter — Refer to Service General.	81-14	81-75
Additions to Four-Cylinder Engine Identification Codes — Service Technical Letter — Refer to Service General.	81-12	81-85
Revision to DRB No. 81-1, Engine Noise Diagnosis, Dated November 27, 1980, Filed Under POWER PLANT - Engines — Service Technical Letter — Refer to Service General.	81-9	81-88
Oil Leak From Distributor Base — 1980-81 Four-Cylinder Engines — Service Technical Letter — Refer to Service General.	81-9	81-88
Short Oil Pump Attaching Screw Torque Revision — 1981 Six-Cylinder Engines — Service Technical Letter — Refer to Service General.	81-6	81-92
1981 Six-Cylinder Main Bearing Capscrew Torque Revision — Service Technical Letter — Refer to Service General.	81-4	81-94
Valve Train Noise — 1981 Six-Cylinder Engines Built Prior to Engine Code 008C01 — Service Technical Letter - Refer to Service General.	81-1	81-97

## 1981 COOLING SYSTEM

Subject (Problem and Application)	Bulletin Number	Page
Air Conditioning Back Idler Pulley Noise — 1981 California Jeep Cherokee, Wagoneer, and Truck Models Built Prior to VIN 1 JTNA25N5BTO15502 Equipped With Six-Cylinder Engine and Air Conditioning	81-3	81-8
Serpentine Drive Belt — 1981 California Jeep Vehicles With Six-Cylinder Engine, Power Steering, Air Conditioning and 55 or 63 Amp Alternator.	81-1	81-9
Six-Cylinder Engine Block Heater — 1981 Jeep Six-Cylinder Engines Equipped With Engine Block Heater and Built Prior to Engine Build Date Code 011C01.	81-2	81-10
1981 Jeep Six-Cylinder Engine Water Pump and Tempatrol Fan Drive Assembly Usage — Service Technical Letter — Refer to Service General.	81-5	81-93

## 1981 ENGINE ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
The Front housing of some 70 and 80 Amp. Alternators on 1981-82 Wagoneer, Cherokee, and Truck Models with Eight-Cylinder Engine and Air Conditioning may crack at the Upper Mounting Boss and cause a Vibration.	1-11-82	82-5
Unnecessary replacement of Electronic Regulator used with 1981-82 Jeep Cruise Command Systems.	1-04-82	82-19
New Voltage Regulator Tester — 1975-81 Jeep Vehicles	81-1	81-12
Revision to DRB 81-1, New Voltage Regulator Tester, Dated June 11, 1981, Filed Under POWER PLANT — Engine Electrical — Service Technical Letter — Refer to Service General.	81-18	81-71

## 1981 FUEL AND EXHAUST SYSTEMS

Subject (Problem and Application)	Bulletin Number	Page
Catalytic Converter Heat Shield — 1981 California Six-Cylinder Cherokee and Wagoneer Models Built Prior to VIN 1 JCNE15N7BT033109.	81-3	81-13
Heated Intake Manifold Diagnosis — 1981 Jeep Vehicles With Six-Cylinder Engine.	81-2	81-14
Altitude Performance Adjustments — 1981 Jeep Vehicles	81-1	81-16
Correction to Carburetor Numbers and Usage — 1981 Jeep CJ Models With Four-Cylinder Engine - Service Technical Letter — Refer to Service General.	81-7	81-90
Correction to 1980-81 Cherokee and Wagoneer Fuel Tank Capacity Specification Charts — Service Technical Letter — Refer to Service General	81-6	81-92
Fuel Feedback Modules Damaged by Incorrect Battery Cable Connection — 1980-81 Jeep Vehicles Equipped With Fuel Feedback System - Service Technical Letter - Refer to Service General	81-4	81-94

## 1981 CLUTCH-MANUAL TRANSMISSION

Subject (Problem and Application)	Bulletin Number	Page
Improper Servicing of the Reverse Gear Shift Rail on 1981-82 Jeep T-176 Manual Transmissions built after June 29, 1981 beginning with Serial Number RGFB-2695.	2-04-82	82-36
SR4 Four-Speed Manual Transmission Vent — 1980-81 CJ and Scrambler Models with SR4 Four-Speed Manual Transmission.	81-1	81-17

## 1981 CLUTCH-MANUAL TRANSMISSION (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Correction to Clutch Aligning Tool Number — 1980 Jeep Technical Service Manual Supplement and 1980-81 Jeep Technical Service Manuals - Service Technical Letter - Refer to Service General.	81-8	81-89
Reverse Gear Selector Pivot Pin Service — 1980-81 SR4 Four-Speed Manual Transmission - Service Technical Letter - Refer to Service General	81-4	81-94

## 1981 AUTOMATIC TRANSMISSION

Subject (Problem and Application)	Bulletin Number	Page
The Clutch Plate Clearance Specification for Model 727 Automatic Transmissions with 4 Disc Front Clutches, is incorrect in the 1980-81-82 Jeep Technical Service Manuals and 1980-81-82 Jeep Service Specifications Handbooks.	2-03-82	82-39
TSPRING (Type "S" Campaign); Automatic Transmission Throttle Control Rod Spring and Hitch Pin may be Improperly Installed — 1981 — Jeep CJ-7, Cherokee, Wagoneer, and Truck.	2-03-82	81-18
Torque Converter Turbine Hub and Transmission Input Shaft Splines — 1981 Jeep CJ Models With Four-Cylinder Engine and Model 904 Automatic Transmission.	81-2	81-21
Correction to Automatic Transmission Stall Speed Specifications Chart in 1981 Jeep Technical Service Manual and 1981 Jeep Service Specifications Handbook — Service Technical Letter — Refer to Service General.	81-11	81-86

## 1981 TRANSFER CASE/QUATRA-TRAC

Subject (Problem and Application)	Bulletin Number	Page
Transfer Case Shift Lever rattles or makes a buzzing noise in some 1980-82 CJ and Scrambler Models.	3-04-82	81-24
Difficulty Shifting into and out of Four-Wheel Drive on some 1980-82 CJ and Scrambler Models with Model 300 Transfer Case.	2-05-82	82-37
Chirp Noise Caused by Transfer Case Input Gear Thrust Bearing Race or Front Output Shaft Thrust Bearing Races — 1981 Jeep Cherokee, Wagoneer, and Truck Models with Model 219 Quadra-Trac Transfer Case Built Prior to June 5, 1981.	81-2	81-26
Transfer Case Output Shaft Seal Leak Diagnosis — 1980-81 Jeep Vehicles Equipped With Model 219 Quadra-Trac Transfer Case.	81-1	81-27
Oil Return Channel Access Hole Plug Service — 1980-81 Jeep Model 219 Quadra-Trac Transfer Case - Service Technical Letter - Refer to Service General.	81-10	81-87
Revision to Part Number in DRB 81-1, Transfer Case Output Shaft Seal Leak Diagnosis, Dated February 23, 1981 and Filed Under CHASSIS -Transfer Case/Quadra-Trac — Service Technical Letter - Refer to Service General.	81-10	81-87

## 1981 BRAKES-WHEELS-TIRES

Subject (Problem and Application)	Bulletin Number	Page
Disc Brake Calliper Pistons in Some 1976-82 Jeep Vehicles may Develop a Light Coating of Rust on the Surface under the Dust Seal Outboard of the Piston Seal.	3-02-82	82-45
Parking Brake Lever to Equalizer Cable may Contact Transfer Case — 1981 Cherokee, Wagoneer and Truck Models with Six-Cylinder Engine and Automatic Transmission.	81-1	81-29

## 1981 STEERING AND SUSPENSION

Subject (Problem and Application)	Bulletin Number	Page
Power Steering Pressure Test Gauge Adapter Set Tool Number Revision — Service Technical Letter - Refer to Service General.	81-6	81-91
Front Wheel Alignment Specifications for 1981 CJ Models - Service Technical Letter - Refer to Service General.	81-3	81-95

## 1981 BODY GENERAL

Subject (Problem and Application)	Bulletin Number	Page
1981-82 CJ Metal Door Lock and Latch Service.	5-03-82	81-30
Discoloration of Finish Coat on Wood Side Rails — 1981-82 Scrambler and Sportside Truck.	5-02-82	81-33
Power Windows on 1980-82 Wagoneer, Cherokee, Truck Models may Make Noise When Operated.	5-01-82	81-34
Improved Method for Retaining Electrically Operated Tailgate Glass in Lower Channel — 1979-81 Cherokee and Wagoneer Models with 5/32-Inch Thick Electrically Operated Tailgate Glass.	81-3	81-36
1981 Jeep Anti-Corrosion Program — All 1981 Jeep Vehicles.	81-2	81-39
New Inside and Outside Door Handles — 1981 CJ-7 Models With Metal Doors.	81-1	81-41
Plastic Front Frame Crossmember Cover Attachment — 1981 CJ Models — Service Technical Letter — Refer to Service General.	81-16	81-73

## 1981 BODY ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
Oil Pressure Gauge Needle Flutters - 1979-82 CJ and Scrambler.	8-5-82	81-44
Center Horn Button Cap On Some 1981-82 Jeep Vehicles may Rattle.	8-03-82	82-59
Cherokee, Wagoneer, Truck Windshield Wiper Linkage R&R Procedures In 1981-82 Jeep Manuals are Incorrect.	8-01-82	82-63
Windshield Wipers Inoperative on Low and Intermittent Speeds — 1980-81 Cherokee, Wagoneer and Truck Models - Addition to Windshield Wiper Service Diagnosis, Page 3T-11 In 1980-81 Jeep Technical Service Manuals - Service Technical Letter - Refer to Service General.	81-8	81-89

## 1981 HEATER-AIR CONDITIONING

Subject (Problem and Application)	Bulletin Number	Page
Air Control Cable Operation — 1978-81 CJ-5 and CJ-7 Models	81-1	81-45
Delco Air Conditioning Compressor Mainshaft Rotating Torque Specification — 1981 Jeep Vehicles — Service Technical Letter — Refer to Service General.	81-16	81-73

## 1981 INSTRUMENT PANELS-SEAT ASSEMBLIES

Subject (Problem and Application)	Bulletin Number	Page
The Odometer on Some 1981-82 Wagoneer, Cherokee, and Truck Models may Generate a High-Pitched Squeaking Noise that Occurs Only Occasionally and at any Speed.	9-02-82	81-46
Drivers Side Front Seat Abrasion — 1981 CJ-7 Models With Padded Roll Bar and Shoulder Belt System.	81-2	81-48
CJBELT (Type "S" Campaign): Incorrect Rear Seat Belts May Have Been Installed — 1981 Jeep CJ-5 and CJ-7.	81-1	81-50
Stationary Center Armrest — 1981 Cherokee, Wagoneer, and Truck Models - Service Technical Letter - Refer to Service General.	81-2	81-96



**HEADLINING-HARDTOP ENCLOSURE-EXTERIOR DECALS AND OVERLAYS**

<b>Subject (Problem and Application)</b>	<b>Bulletin Number</b>	<b>Page</b>
Hardtop Inner Panel (Headliner) Touches Hardtop Outer Panel on Some 1981-82 Scrambler Models Causing Buzz or Flutter Noise.	9-03-82	81-54
Hardtop Squeak Caused by Access Cover Position — 1981 Jeep Scrambler Models Built Prior to VIN 1JXXXXXXXXX070034 Equipped with Hardtop.	81-1	81-56
Sun Roof Glass Frame Seal — 1980-81 Cherokee, Wagoneer, and Truck Models With Manual Sun Roof.	81-2	81-57
Fabric Top Kit Components — 1981 Scrambler Models Built Between VIN 1JXXXXXXXXX040711 and VIN 1JXXXXXXXXX063179 Equipped with Fabric Top and Fabric Doors — Service Technical Letter — Refer to Service General.	81-17	81-72

**1981 METAL REPAIR-PAINTING-WATER LEAK/WIND NOISE**

<b>Subject (Problem and Application)</b>	<b>Bulletin Number</b>	<b>Page</b>
Hardtop Rear Window Water Leaks — 1981 Jeep Scrambler Models With Hardtop.	81-5	81-58
1981 Phase-Out/1982 Phase-In Program Paint Information — 1981 1981 Jeep Vehicles.	81-4	81-59
Paint Peeling Off Road Wheels — 1981 Jeep Vehicles Built Between VIN 1JXXXXXXXXX015701 and VIN 1JXXXXXXXXX042000 and Equipped with Painted — White Road Wheels.	81-3	81-62
Water Leak or Wind Noise Recommended Sealing Products — All 1980-81 Jeep Vehicles.	81-2	81-63
Paint Information — All 1981 Jeep Vehicles.	81-1	81-64
Interior Wind Noises — 1980-81 Cherokee, Wagoneer, and Truck Models	80-3	81-68

**1981 SERVICE GENERAL**

<b>Subject (Problem and Application)</b>	<b>Bulletin Number</b>	<b>Page</b>
Revision to Diagnosis and Repair Bulletin 81-1, New Voltage Regulator Tester, Dated June 11, 1981, Filed Under POWER PLANT — Engine Electrical.	81-18	81-71
Oil Pump Release (Relief) Valve Plunger — Six-Cylinder Oil Pump — Revision to Service Technical Letter 81-15 Dated May 19, 1981.	81-17	81-72
Fabric Top Kit Components — 1981 Scrambler Models Built Between VIN 1JXXXXXXXXX040711 and VIN 1JXXXXXXXXX063179 Equipped with Fabric Top and Fabric Doors.	81-17	81-72
Plastic Front Frame Crossmember Cover Attachment — 1981 CJ Models.	81-16	81-73
Delco Air Conditioning Compressor Mainshaft Rotating Torque Specification — 1981 Jeep Vehicles.	81-16	81-73
Oil Pump Release Valve Plunger — 1981 Six-Cylinder Oil Pump	81-15	81-74
Revision to 1981 Six-Cylinder PCV Valve Specifications.	81-14	81-75
New Model Information — 1981 Jeep Scrambler.	81-13	81-76
Additions to 1981 Four-Cylinder Engine Identification Codes.	81-12	81-85
Correction to Automatic Transmission Stall Speed Specifications Chart In 1981 Jeep Technical Service Manual and 1981 Jeep Service Specifications Handbook.	81-11	81-86
Revision to Part Number In DRB 81-1, Transfer Case Output Shaft Seal Leak Diagnosis, Dated February 23, 1981, and Filed Under CHASSIS - Transfer Case/Quadra-Trac.	81-10	81-87

## 1981 SERVICE GENERAL (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Oil Return Channel Access Hole Plug Service — 1980-81 Jeep Model 219 Quadra-Trac Transfer Case.	81-10	81-87
Revision to Diagnosis and Repair Bulletin No. 81-1, Engine Noise Diagnosis, Dated November 27, 1980, Filed Under POWER PLANT - Engines.	81-9	81-88
Oil Leak From Distributor Base — 1980-81 Four-Cylinder Engines.	81-9	81-88
Windshield Wipers Inoperative On Low and Intermittent Speeds — 1980-81 Cherokee, Wagoneer, and Truck Models - Addition to Windshield Wiper Service Diagnosis, Page 3T-11 In 1980-81 Jeep Technical Service Manuals.	81-8	81-89
Correction to Clutch Aligning Tool Number — 1980 Jeep Technical Services Manual Supplement and 1980-81 Jeep Technical Service Manuals.	81-8	81-89
Correction to Carburetor Numbers and Usage — 1981 Jeep CJ Models With Four-Cylinder Engine.	81-7	81-90
Water Leaks Caused By Dealer Installed Radio Antenna — 1981 Jeep Vehicles.	81-6	81-91
Power Steering Pressure Test Gauge Adapter Set Tool Number Revision.	81-6	81-91
Correction to 1980-81 Cherokee and Wagoneer Fuel Tank Capacity Specification Charts.	81-6	81-92
Correction to 1980 Jeep Four-Cylinder Engine Piston Fit Information.	81-6	81-92
Short Oil Pump Attaching Screw Torque Specification Revision — 1981 Six-Cylinder Engines.	81-6	81-92
1981 Jeep Six-Cylinder Engine Water Pump and Tempatrol Fan Drive Assembly Usage.	81-5	81-93
1981 Six-Cylinder Main Bearing Capscrew Torque Revision.	81-4	81-94
Reverse Gear Selector Pivot Pin Service — 1980-81 SR4 Four-Speed Manual Transmission.	81-4	81-94
Fuel Feedback Modules Damaged By Incorrect Battery Cable Connection — 1980-81 Jeep Vehicles Equipped With Fuel Feedback System.	81-4	81-94
Front Wheel Alignment Specifications for 1981 CJ Models.	81-3	81-95
Stationary Center Armrest — 1981 Cherokee, Wagoneer, and Truck Models.	81-2	81-96
Valve Train Noise — 1981 Six-Cylinder Engines Built Prior to Engine Code 008C01	81-1	81-97

## 1980 ENGINE

Subject (Problem and Application)	Bulletin Number	Page
Carbon Knock — 1980-81 Jeep Vehicles With Four-, Six-, or Eight-Cylinder Engine.	81-2	80-1
Six-Cylinder Camshaft Pin Breakage — 1977-80 Jeep Vehicles with Six-Cylinder Engine.	80-3	80-2
Exhaust Manifold to Exhaust Pipe Studs and Nuts — 1980 Jeep Vehicles with Six-Cylinder Engine.	80-2	80-4
Rear Crossmember and Torque Reaction Bracket Reposition — 1980 CJ-7 Four-Cylinder Equipped Vehicles Built Between VIN J0M93XX009040 and J0M93XX014233	80-1	80-5
Oil Leak From Distributor Base — 1980-81 Four-Cylinder Engines - Service Technical Letter - Refer to Service General.	81-9	81-88

## 1980 ENGINE (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Correction to 1980 Jeep Four-Cylinder Engine Piston Fit Information - Service Technical Letter - Refer to Service General.	81-6	80-94
Standard Oil Filter Damaged During Severe Off-Road Operation — 1974-80 Jeep Cherokee-Wagoneer-Truck Models with Six-Cylinder Engine - Service Technical Letter - Refer to Service General.	80-18	80-98
Engine Oil Capacity — 1980 Jeep Four-Cylinder Engines - Service Technical Letter - Refer to Service General.	80-13	80-103
Revised Crankshaft Main Bearing Clearance Specifications for 1980 Six-Cylinder Engines — Service Technical Letter - Refer to Service General.	80-11	80-105
Camshaft Spring Pin Correction — Six-Cylinder Camshaft Pin Breakage on 1977-80 Jeep Vehicles - DRB 80-3 dated February 4, 1980, filed under Power Plant - Engines - Service Technical Letter - Refer to Service General.	80-7	80-109
Assembling Piston and Connecting Rod — 1980 Four-Cylinder Engines - Service Technical Letter - Refer to Service General.	80-6	80-110

## 1980 COOLING SYSTEM

Subject (Problem and Application)	Bulletin Number	Page
Coolant Recovery Return Hose Kinked — 1980 Cherokee, Wagoneer, and Truck Models With Six-Cylinder Engine.	80-1	80-6
Radiator Hose Clamp Torque Specifications — 1980 Jeep Vehicles - Service Technical Letter - Refer to Service General.	80-12	80-104
Correct Tempatrol Fan Assembly Storage — 1980 and Prior Jeep Models - Service Technical Letter - Refer to Service General.	80-3	80-113

## 1980 ENGINE ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
New Voltage Regulator Tester — 1975-81 Jeep Vehicles.	81-1	81-12
Spark Knock Repair — 1980 49-State Cherokee and J-10 Truck Models with Manual Transmission, 360 CID Engine, and Standard or Heavy-Duty Cooling.	80-2	80-7
Electric Choke and Idle Solenoid Feed Wire Routing — 1980 Jeep Models with Six-Cylinder Engine.	80-1	80-10
Revision to Diagnosis and Repair Bulletin No. 80-6, Exhaust Gas Recirculation (EGR) System Revision, Dated October 27, 1980, Filed Under — POWER PLANT — Fuel and Exhaust Systems - Service Technical Letter - Refer to Service General.	80-19	80-97
Two-Stage Power Valve — Carburetor Models 2100 and 2150 — 1978-80 Jeep Vehicles - Service Technical Letter - Refer to Service General.	80-16	80-100
Revised Exhaust Pipe-to-Manifold Fastener Torque Specifications — 1980 Four-Cylinder Engines - Service Technical Letter - Refer to Service General.	80-11	80-105
Relocation of Safety Certification and Emission Control Labels — 1980 Jeep CJ Models - Service Technical Letter - Refer to Service General.	80-1	80-116

## 1980 FUEL AND EXHAUST SYSTEMS

Subject (Problem and Application)	Bulletin Number	Page
Altitude Performance Adjustments — 1968-80 Jeep Vehicles.	80-7	80-11

## 1980 FUEL AND EXHAUST SYSTEMS (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Exhaust Gas Recirculation (EGR) System Revision — 1980 49-State Cherokee, Wagoneer, and Truck Models with 360 CID Engine, Automatic Transmission, 2.73 or 3.31 Ratio Axles and Standard or Heavy-Duty Coding System.	80-6	80-12
Running Change to Four-Cylinder Engine Choke System — 1980 CJ Models with Four-Cylinder Engine.	80-5	80-15
Fuel Tank Sending Unit Service — 1980 Cherokee and Wagoneer Models Built after December 17, 1979.	80-4	80-17
Microprocessor (ECM) Shield — 1980 California CJ Models With Four-Cylinder Engine Built Prior to VIN J0M93AB058103.	80-3	80-18
Vacuum Diagram Correction to 1980 Jeep Technical Service Manual — 1980 49-State Cherokee and J-10 Truck Models With 360 CID Eight-Cylinder Engine, Manual Transmission and Heavy-Duty Cooling.	80-2	80-20
Exhaust Pipe to Exhaust Manifold Leak — 1980 Six-Cylinder Equipped Jeep Models.	80-1	80-22
Correction to 1980-81 Jeep Vehicles Equipped with Fuel Feedback System - Service Technical Letter - Refer to Service General.	81-6	81-92
Fuel Feedback Modules Damaged by Incorrect Battery Cable Connection — 1980-81 Jeep Vehicles Equipped with Fuel Feedback System - Refer to Service General.	81-4	81-94

## 1980 CLUTCH-MANUAL TRANSMISSION

Subject (Problem and Application)	Bulletin Number	Page
SR4 Four-Speed Manual Transmission Vent — 1980-81 CJ and Scrambler Models with SR4 Four-Speed Transmission.	81-1	81-17
T-176 Four-Speed Manual Transmission Used in 1980 Four-Cylinder CJ Models Built Between VIN J0M93AB725578 and VIN J0M93B727300	80-4	80-23
Clutch Pedal Return Adjustment — 1980 CJ Models With Manual Transmission and Six- or Eight-Cylinder Engine.	80-3	80-24
T-176 Four-Speed Manual Transmission Shift Problems — 1980 Jeep CJ, Cherokee, and J-10 Truck Models With T-176 4-Speed Manual Transmission.	80-2	80-25
Inspection of Clutch Housing and Clutch Lever Clearance — 1980 Cherokee, Wagoneer, and Truck Models With Manual Transmission Built Prior to VIN J0D25NN008776.	80-1	80-28
Correction to Clutch Aligning Tool Number — 1980 Jeep Technical Service Manual Supplement and 1980-81 Jeep Technical Service Manuals - Service Technical Letter - Refer to Service General	81-8	80-93
Reverse Gear Selector Pivot Pin Service — 1980-81 SR4 Four-Speed Manual Transmission Service Technical Letter - Refer to Service General.	81-4	80-96
Model T-176 Four-Speed Manual Transmission Released as a Production Option to Model SR-4 4-Speed Manual Transmission — 1980 CJ-7 Models Built With Six-Cylinder Engine and Manual Transmission - Service Technical Letter - Refer to Service General.	80-2	80-114

## 1980 AUTOMATIC TRANSMISSION

Subject (Problem and Application)	Bulletin Number	Page
The Clutch Plate Clearance Specification for Model 727 Automatic Transmissions with 4 Disc Front Clutches, is Incorrect in the 1980-81-82 Jeep Technical Service Manuals and 1980-81-82 Jeep Service Specifications Handbooks.	2-03-82	82-39
Moan or Buzzing Noise From Automatic Transmission When Shifting Into Reverse — 1980 Jeep CJ Models With Model 999 Automatic Transmission Built Prior to Build Date Code 6863.	80-1	80-31

## 1980 AUTOMATIC TRANSMISSION (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Speedometer Adapter O-Ring Seal — 1980 Cherokee, Wagoneer, and Truck Models With Transfer Case Model 208 or 219 - Service Technical Letter - Refer to Service General.	80-12	80-104

## 1980 TRANSFER CASE/QUADRA-TRAC

Subject (Problem and Application)	Bulletin Number	Page
Transfer Case Shift Lever Rattles or Makes a Buzzing Noise in some 1980-82 CJ and Scrambler Models.	3-04-82	80-33
Difficulty Shifting into and out of Four-Wheel Drive on some 1980-82 CJ and Scrambler Models with Model 300 Transfer Case.	2-05-82	82-37
Transfer Case Drive Sprocket Thrust Washer Noise - 1980 Jeep Cherokee, Wagoneer, and Truck Models with Model 208 Transfer Case.	80-3	80-35
Transfer Case Output Shaft Seal Leak Diagnosis — 1980-81 Jeep Vehicles Equipped With Model 219 Quadra-Trac Transfer Case.	81-1	80-37
Transfer Case Shift Lever Rattle — 1980 Cherokee, Wagoneer, and Truck Models With Automatic Transmission.	80-2	80-39
Transfer Case Shift Lever and Shaft Replacement — 1980 CJ Models.	80-1	80-40
Revision to Part Number in DRB 81-1, Transfer Case Output Shaft Seal Leak Diagnosis, Dated February 23, 1981 and Filed Under CHASSIS - Transfer Case/Quadra-Trac — Service Technical Letter - Refer to Service General.	81-10	80-92
Oil Return Channel Access Hole Plug Service — 1980-81 Jeep Model 219 Quadra-Trac Transfer Case - Service Technical Letter - Refer to Service General.	81-10	80-92
Revision to Diagnosis and Repair Bulletin No. 80-1, Transfer Case Shift Lever and Shaft Replacement, Dated January 9, 1980, Filed Under CHASSIS — Transfer Case/Quadra-Trac - Service Technical Letter - Refer to Service General.	80-17	80-99
Correction to Quadra-Trac Differential End Cap Attaching Screw Torque — 1976 Jeep Technical Service Manual - Service Technical Letter - Refer to Service General.	80-13	80-103
Correction to In-Vehicle Torque Bias Check — 1980 Cherokee, Wagoneer, and Truck Models With Model 219 Quadra-Trac Transfer Case - Service Technical Letter - Refer to Service General.	80-4	80-112
Part Number Change — Service Technical Letter Number 80-2 Dated November 10, 1979 - Service Technical Letter - Refer to Service General.	80-3	80-113
Four-Wheel Drive Indicator Lamp Operation and Switch Usage — 1980 Jeep Cherokee, Wagoneer, and Truck Models With Model 208 or 219 Transfer Case - Service Technical Letter - Refer to Service General.	80-2	80-114

## 1980 AXLES-PROPELLER SHAFT

Subject (Problem and Application)	Bulletin Number	Page
JEEPAXLE (Type "S" Product Recall Campaign): Rear Wheel Bearing Retainers and Seals May Have Been Assembled Improperly — 1979-80 Jeep Cherokee, Wagoneer, and J-10 Truck Models.	80-3	80-41
UJOINT (Type "S" Product Recall Campaign): Propeller Shaft U-Joint-to-Yoke Attaching Bolts and Clamps — 1979-80 Jeep CJ	80-2	80-45
Revised Procedure for Measuring and Correcting Steering Knuckle Ball Stud Preload — 1980 CJ Models.	80-1	80-48
New Propeller Shaft-to-Yoke Attaching Bolt — All 1980 Jeep Vehicles - Service Technical Letter - Refer to Service General.	80-5	80-111

## 1980 BRAKES-WHEEL-TIRES

Subject (Problem and Application)	Bulletin Number	Page
Disc Brake Caliper Pistons in Some 1976-82 Jeep Vehicles May Develop a Light Coating of Rust on the Surface Under the Dust Seal Outboard of the Piston Seal.	3-02-82	82-45
Disc Brake Noise — 1978-79-80 Cherokee, Wagoneer, and Truck Models.	80-1	80-51
Tire Vibration — 1979-80 131-Inch Wheelbase J-10 Truck Models With H78-15, Load Range B, Firestone Town and Country Tires - Service Technical Letter - Refer to Service General.	80-16	80-100
Chrome Wheel Discoloration — 1980 Jeep Models Equipped With Chrome Wheels - Service Technical Letter - Refer to Service General.	80-10	80-106

## 1980 STEERING AND SUSPENSION

Subject (Problem and Application)	Bulletin Number	Page
Correction to Camber Specifications — 1980 Cherokee, Wagoneer, and Truck Models - Service Technical Letter - Refer to Service General.	80-4	80-112

## 1980 BODY GENERAL

Subject (Problem and Application)	Bulletin Number	Page
Power Windows on some 1980-82 Wagoneer, Cherokee, and Truck Models May Make Noise When Operated.	5-01-82	80-52
Improved Method for Retaining Electrically Operated Tailgate Glass in Lower Channel — 1979-81 Cherokee and Wagoneer Models with 5/32-inch Thick Electrically Operated Tailgate Glass.	81-3	81-36
Underbody Spare Wheel Mounting Bar — 1980 Cherokee and Wagoneer Models Built Prior to VIN J0M17NC065724 (June 19, 1980).	80-2	80-54
Soft Top with Metal Door Fit — 198 CJ Models With Soft Top and Metal Doors.	80-1	80-55
1980 Cherokee and Wagoneer Bumper Jack — Service Technical Letter - Refer to Service General.	80-9	80-107

## 1980 BODY ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
Oil Pressure Gauge Needle Flutters during Engine Operation on some 1979-82 CJ and Scrambler Models.	8-05-82	80-56
Power Sun Roof Option — 1980 Wagoneer Limited Models.	80-8	80-57
Instrument Cluster Lens — 1980 CJ-5 and CJ-7 Models.	80-7	80-66
Power Window Operation and Diagnosis — 1980 Cherokee, Wagoneer, and Truck Models Equipped With Power Windows and Built Prior to VIN J0D15NC053176.	80-6	80-68
AM/FM Stereo Radio Option — 1980 CJ-5 and CJ-7 Models.	80-5	80-69
Stereo Radio Rear Speakers Missing — 1980 Cherokee Laredo Models Built Prior to VIN J0E17NN027333.	80-4	80-70
JLAMP CAMPAIGN (Type "S" Product Recall Campaign): Headlamp Assembly.	80-3	80-72
Moisture Entering Parking and Front Directional Signal Lamp Assembly — 1976-80 CJ Models.	80-2	80-74
Front Door Wire Router Plates — 1980 Wagoneer, Cherokee and Truck Models With Door Speakers.	80-1	80-75

## 1980 BODY ELECTRICAL (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Windshield Wipers Inoperative on Low and Intermittent Speeds — 1980-81 Cherokee, Wagoneer and Truck Models - Addition to Windshield Wiper Service Diagnosis, Page 3T-11 In 1980-81 Jeep Technical Service Manuals - Service Technical Letter - Refer to Service General.	81-8	80-93
Water Leaks Caused By Dealer-Installed Radio Antenna — 1981 Jeep Vehicles - Service Technical Letter - Refer to Service General.	81-6	80-95
AM/FM Radio Right to Left Balance Control Adjustment — 1980 Jeep Vehicles - Service Technical Letter - Refer to Service General.	80-10	80-106
1980 CJ Oil Pressure Gauge — Service Technical Letter - Refer to Service General.	80-9	80-107
Correction to DRB 80-4, Stereo Radio Rear Speakers Missing, Dated February 14, 1980 Filed Under BODY — Body Electrical - Service Technical Letter - Refer to Service General.	80-8	80-108
Revised Fuse Rating for Cigar Lighter Circuit — 1980 Jeep CJ Models With Four- and Six-Cylinder Engines - Service Technical Letter - Refer to Service General.	80-5	80-111
Tape Player Inoperative Caused by Transit Screw — 1980 Jeep Models With AM/FM/Cassette Radio - Service Technical Letter - Refer to Service General.	80-1	80-116

## 1980 HEATER-AIR CONDITIONING

Subject (Problem and Application)	Bulletin Number	Page
Air Control Cable Operation — 1978-81 CJ-5 and CJ-7 Models.	81-1	80-76

## 1980 HEADLINING-HARDTOP ENCLOSURE-EXTERIOR DECALS AND OVERLAYS

Subject (Problem and Application)	Bulletin Number	Page
Sun Roof Glass Frame Seal — 1980-81 Cherokee, Wagoneer, and Truck Models With Manual Sun Roof.	81-2	80-77
Sun Roof Arm Operator — 1979-80 CJ-7 Models With Type-1 Sun Roof	80-2	80-78
New Sun Roof Vinyl Trlm Ring — 1980 Cherokee and Wagoneer Models.	80-1	80-79
Sun Roof Sealer — 1980 Jeep Vehicles - Service Technical Letter - Refer to Service General.	80-18	80-98
Fiberglass Hardtop Interior Appearance — 1980 CJ-7 Models - Service Technical Letter - Refer to Service General.	80-14	80-102

## 1980 METAL REPAIR-PAINTING-WATER LEAK/WIND NOISE

Subject (Problem and Application)	Bulletin Number	Page
Water Leak or Wind Noise Recommended Sealing Products — All 1980-81 Jeep Vehicles.	81-2	80-80
Interior Wind Noises — 1980-81 Cherokee, Wagoneer, and Truck Models.	80-3	80-81
1980 Phase-Out/1981 Phase-In Program Paint Information — 1980 Jeep Vehicles.	80-2	80-84
Paint Information - All Jeep Vehicles — 1980 Jeep Vehicles.	80-1	80-88

# 1980 SERVICE GENERAL

Subject (Problem and Application)	Bulletin Number	Page
Oil Return Channel Access Hole Plug Service — 1980-81 Jeep Model 219 Quadra-Trac Transfer Case.	81-10	80-92
Windshield Wipers Inoperative on Low and Intermittent Speeds — 1980-81 Cherokee, Wagoneer and Truck Models — Addition to Windshield Wiper Service Diagnosis, Page 3T-11 in 1980-81 Jeep Technical Service Manuals.	81-8	80-93
Correction to Clutch Aligning Tool Number — 1980 Jeep Technical Service Manual Supplement and 1980-81 Jeep Technical Service Manuals.	81-8	80-93
Power Steering Pressure Test Gauge Adapter Set Tool Number Revision.	81-6	80-94
Correction to 1980-81 Cherokee and Wagoneer Fuel Tank Capacity Specification Charts.	81-6	80-94
Correction to 1980 Jeep Four-Cylinder Engine Piston Fit Information.	81-6	80-94
Reverse Gear Selector Pivot Pin Service — 1980-81 SR4 Four-Speed Manual Transmission.	81-4	80-96
Fuel Feedback Modules Damaged By Incorrect Battery Cable Connection — 1980-81 Jeep Vehicles Equipped With Fuel Feedback System.	81-4	80-96
Revision to Diagnosis and Repair Bulletin No. 80-6 — Exhaust Gas Recirculation (EGR) System Revision, Dated October 27, 1980, Filed Under Power Plant — Fuel and Exhaust Systems.	80-19	80-97
Sun Roof Sealer — 1980 Jeep Vehicles.	80-18	80-98
Standard Oil Filter Damaged During Severe Off-Road Operation — 1974-80 Jeep Cherokee, Wagoneer, and Truck Models With Six-Cylinder Engine.	80-18	80-98
SR4 Four-Speed Manual Transmission Changed for 1980 Models.	80-17	80-99
Revision to Diagnosis and Repair Bulletin No. 80-1, Transfer Case Shift Lever and Shaft Replacement, Dated January 9, 1980, Filed Under CHASSIS — Transfer Case/Quadra-Trac.	80-17	80-99
Two-Stage Power Valve — Carburetor Models 2100 and 2150 — 1978-80 Jeep Vehicles.	80-16	80-100
Tire Vibration — 1979-80 131-Inch Wheelbase J-10 Truck Models with H78-15, Load Range B, Firestone Town and Country Tires.	80-16	80-100
Cracked Coupler Nut on Tow Bars (Part Number SE2127000) Ordered From a Jeep PDC Between January 1, 1980 Through May 31, 1980 — CJ Models.	80-15	80-101
Fiberglass Hardtop Interior Appearance — 1980 CJ-7 Models.	80-14	80-102
Correction to Quadra-Trac Differential End Cap Attaching Screw Torque — 1976 Jeep Technical Service Manual.	80-13	80-103
Engine Oil Capacity — 1980 Jeep Four-Cylinder Engines.	80-13	80-103
Radiator Hose Clamp Torque Specifications — 1980 Jeep Vehicles	80-12	80-104
Speedometer Adapter O-Ring Seal — 1980 Cherokee, Wagoneer, and Truck Models With Transfer Case Model 208 or 219.	80-12	80-104
Revised Crankshaft Main Bearing Clearance Specifications for 1980 Six-Cylinder Engines.	80-11	80-105
Revised Exhaust Pipe-to-Manifold Fastener Torque Specifications — 1980 Four-Cylinder Engines.	80-11	80-105
AM/FM Radio Right to Left Balance Control Adjustment — 1980 Jeep Vehicles.	80-10	80-106
Chrome Wheel Discoloration — 1980 Jeep Models Equipped With Chrome Wheels.	80-10	80-106



## 1980 SERVICE GENERAL (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
1980 CJ Oil Pressure Gauge.	80-9	80-107
1980 Cherokee and Wagoneer and Bumper Jack.	80-9	80-107
Correction to Diagnosis and Repair Bulletin No. 80-4, Stereo Radio Rear Speakers Missing, Dated February 14, 1980, Filed Under Body — Body Electrical.	80-8	80-108
Camshaft Spring Pin Correction — Six-Cylinder Camshaft Pin Breakage on 1977-80 Jeep Vehicles - DRB 80-3, Dated February 4, 1980, Filed Under Power Plant — Engines.	80-7	80-109
Assembling Piston and Connecting Rod — 1980 Four-Cylinder Engines.	80-6	80-110
New Propeller Shaft-to-Yoke Attaching Bolt — All 1980 Jeep Vehicles.	80-5	80-111
Revised Fuse Rating for Cigar Lighter Circuit — 1980 Jeep CJ Models With Four- and Six-Cylinder Engines.	80-5	80-111
Correction to In-Vehicle Torque Bias Check — 1980 Cherokee, Wagoneer, and Truck Models With Model 219 Quadra-Trac Transfer Case.	80-4	80-112
Correction to Camber Specifications — 1980 Cherokee, Wagoneer, and Truck Models.	80-4	80-112
Correct Tempatrol Fan Assembly Storage — 1980 and Prior Jeep Models.	80-3	80-113
Part Number Change — Service Technical Letter Number 80-2, Dated November 10, 1979.	80-3	80-113
Four Wheel Drive Indicator Lamp Operation and Switch Usage — 1980 Jeep Cherokee, Wagoneer, and Truck Models With Model 208 or 219 Transfer Case.	80-2	80-114
Model T-176 4-Speed Manual Transmission Released as a Production Option to Model SR-4 4-Speed Manual Transmission — 1980 CJ Models With Six-Cylinder Engine and Manual Transmission.	80-2	80-114
Revised Clutch Overcenter Spring Removal Procedures — 1979 CJ Models Built After Mid-April.	80-2	80-115
Tape Player Inoperative Caused By Transit Screw — 1980 Jeep Models AM/FM Cassette Radio.	80-1	80-116
Relocation of Safety Certification and Emission Control Labels — 1980 Jeep CJ Models.	80-1	80-116

## 1979 ENGINE

Subject (Problem and Application)	Bulletin Number	Page
Six-Cylinder Camshaft Pin Breakage — 1977-80 Jeep Vehicles with Six-Cylinder Engine.	80-3	79-1
New Timing Chain Assembly and Deflection Inspection Procedure — 1979 Jeep Vehicles with Eight-Cylinder Engines.	9-01	79-3
Standard Oil Filter damaged during Severe Off-Road Operation — 1974-80 Jeep Cherokee, Wagoneer, Truck Models with Six-Cylinder Engine - Service Technical Letter - Refer to Service General.	80-18	79-82
Camshaft Spring Pin Correction — Six-Cylinder Camshaft Pin Breakage on 1977-80 Jeep Vehicles - DRB 80-3 dated February 4, 1980, filed under Power Plant - Engines - Service Technical Letter - Refer to Service General.	80-7	79-84
Compression Pressure Specification Update - 1977-79 Six- and Eight-Cylinder Engines - Service Technical Letter - Refer to Service General.	9-05	79-94

## 1979 COOLING SYSTEM

Subject (Problem and Application)	Bulletin Number	Page
Correct Tempatrol Fan Assembly Storage — 1980 and Prior Jeep Models - Service Technical Letter - Refer to Service General.	80-3	80-113

## 1979 ENGINE ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
New Voltage Regulator Tester	81-1	79-4
Tachometer RPM Drop When Operating Cigar Lighter or Backup Lamps — 1979 CJ Models Equipped with a Tachometer.	9-04	79-5
Oil Pressure Gauges and Sending Units — All 1979 CJ Models.	9-03	79-6
Ammeter Circuit and Wiring Diagram Revisions — 1978-1979 Wagoneer, Cherokee and Truck Models.	9-02	79-8
Choke Jumper Harness — 1979 Wagoneer Cherokee and Truck Models Equipped With a V-8 Engine and Electric Choke.	9-01	79-9
Two-Stage Power Valve - Carburetor Models 2100 and 2150 — 1978-80 Jeep Vehicles - Service Technical Letter - Refer to Service General.	80-16	79-83
1979 Jeep Models — Severe Engine Spark Knock While Trailer Towing or During Heavy Load Operatlon - Service Technical Letter - Refer to Service General.	9-09	79-90
Service Technical Letter No. 9-02, Dated October 2, 1978 - All 1979 Jeep Models - Starter Solenoid With Blade Terminals - Refer to Service General.	9-03	79-96
All 1979 Jeep Models - Starter Solenoid With Blade Terminals - Service Technical Letter - Refer to Service General.	9-02	79-98
1979 360 CID V-8 Engine Cold Engine Spark Knock - Service Technical Letter - Refer to Service General.	9-01 Revised	79-99

## 1979 FUEL AND EXHAUST SYSTEMS

Subject (Problem and Application)	Bulletin Number	Page
Altitude Performance Adjustments	80-7	79-11
Engine Performance Diagnosis — 1979 Jeep Six and Eight Cylinder Engines.	9-07	79-12
BASCENS Campaign (Type E Product Recall Campaign): Exhaust Gas Recirculating (EGR) Back Pressure Sensor Replacement and Adjustment of Idle Mixture Setting (Lean Idle Drop Specification Change to 50 RPM for all Six-Cylinder Engines) — 1974-79 Jeep Vehicles.	9-06	79-14
Servicing Fuel Tank and Vapor Control System — Expansion of Procedures in 1979 Technical Service Manual.	9-05	79-18
Left Rear Quarter Panel Rattle — 1978-79 Wagoneer and Cherokee Models.	9-04	79-22
Inaccurate Fuel Gauge Reading at Empty Caused by Incorrect Gas Tank Sending Unit Calibration — 1979 Cherokee and Wagoneer Models.	9-03	79-23
Warm Engine Operation - Supplement to Diagnosis and Repair Bulletin No. 9-01 Dated November 10, 1978 — Some 1979 Jeep Models Built Before J9X15XX047200 and J9X25XX042459 Equipped With 360-2V Engine and Automatic Transmission Except Model 46 Trucks (J-20).	9-02	79-25
Warm Engine Driveability — All 1979 Jeep Vehicles Equipped With 360-2V Engines and Automatic Transmissions Except Model 46 Truck (J-20).	9-01	79-26
New Exhaust Manifold Gasket — Eight-Cylinder Engines - Service Technical Letter - Refer to Service General.	9-13	79-86

## 1979 FUEL AND EXHAUST SYSTEMS (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
1979 Jeep Warm Engine Operation Bulletins - Service Technical Letter - Refer to Service General.	9-11	79-88
Dashpot Adjustment - Addition to 1979 Jeep Technical Service Manual - Service Technical Letter - Refer to Service General.	9-04	79-95
Engine Operation - Service Technical Letter - Refer to Service General.	9-04	79-95

## 1979 CLUTCH-MANUAL TRANSMISSION

Subject (Problem and Application)	Bulletin Number	Page
Improved Procedures for Clutch Overcenter Spring and Clutch Pedal Replacement — 1977-79 CJ Models.	9-02	79-29
CJTRANS Campaign (Type "S" Product Recall Campaign): Vehicle May Have Incorrect Transmission-to-Transfer Case Gasket — 1979 CJ-5 and CJ-7 Models Equipped with Manual Transmission.	9-01	79-31
1979 CJ Model Revised Clutch Linkage Components - Service Technical Letter - Refer to Service General.	9-12	79-87

## 1979 AUTOMATIC TRANSMISSION

Subject (Problem and Application)	Bulletin Number	Page
New Automatic Transmission Forward Clutch Direct Clutch and Oil Pump Assemblies — 1979 Jeep Models With Automatic Transmission.	9-03	79-34
Fluid Overflow From Automatic Transmission Fill Tube or Vent Tube Caused by Overfill or Vent Tube Restriction — 1977-79 Jeep Models With Automatic Transmission.	9-02	79-35
1979 Jeep Technical Service Manual Correction - Automatic Transmission DARS Chart — All 1979 Jeep Models With Automatic Transmission.	9-01	79-36
Forward Clutch Piston Center Seal - All Jeep Models With Automatic Transmission - Service Technical Letter - Refer to Service General.	9-04	79-95
Automatic Transmission Clutch and Band Application Chart - Service Technical Letter - Refer to Service General.	9-03	79-96

## 1979 TRANSFER CASE/QUADRA-TRAC

Subject (Problem and Application)	Bulletin Number	Page
Improved Stick-Slip Correction Procedure — 1973-79 Jeep Vehicles with Quadra-Trac Transfer Case.	9-01	79-37
All Jeep Models Equipped With Quadra-Trac — Transmission-to-Quadra-Trac O-Ring Seal - Service Technical Letter - Refer to Service General.	9-02	79-97

## 1979 AXLES-PROPELLER SHAFTS

Subject (Problem and Application)	Bulletin Number	Page
JEEPAXLE (Type "S" Product Recall Campaign): Rear Wheel Bearing Retainers and Seals May Have Been Assembled Improperly — 1979-80 Jeep Cherokee, Wagoneer, and J-10 Truck Models.	80-3	79-39
U-Joint (Type "S" Product Recall Campaign) Propeller Shaft U-Joint to Yoke Attaching Bolts and Clamps.	80-2	79-43
Rear Axle Housing Cover Service — 1977-79 CJ Models.	9-02	79-46
Revised Ball Stud Preload Correction and Front Wheel Shimmy Procedures — All 1978-79 Jeep Models.	9-01	79-47
1979 Jeep Technical Service Manual Correction - Service Technical Letter - Refer to Service General.	9-02	79-98

## 1979 BRAKES-WHEELS-TIRES

Subject (Problem and Application)	Bulletin Number	Page
Disc Brake Caliper Pistons In Some 1976-82 Jeep Vehicles may Develop a Light Coating of Rust on the Surface under the Dust Seal Outboard of the Piston Seal.	3-02-82	82-45
Disc Brake Noise — 1978-80 Cherokee, Wagoneer, and Truck Models.	80-1	80-51
Brakedrum and Rotor Repair vs. Replacement — All 1976-79 Jeep Vehicles.	9-01	79-48

## 1979 STEERING AND SUSPENSION

Subject (Problem and Application)	Bulletin Number	Page
Power Steering Gear Repair vs. Replacement — All 1977-79 Jeep Vehicles Equipped With Power Steering.	9-01 Revised	79-52
BRAMSTER Campaign (Type "S" Product Recall Campaign): Loose Steering Connecting Rod Adjuster Tube Clamp Bolts — 1979 Jeep CJ-5 and CJ-7 Models Built Between VIN Numbers J9A93EH800007 and J9F93EC801734.	9-02	79-54

## 1979 BODY GENERAL

Subject (Problem and Application)	Bulletin Number	Page
Improved Method for Retaining Electrically Operated Tailgate Glass in Lower Channel — 1979-81 Cherokee and Wagoneer Models with 5/32-Inch Thick Electrically Operated Tailgate Glass.	81-3	79-56
Electrical Operated Tailgate Glass to Lower Channel Retention — 1979 Cherokee and Wagoneer With 5/32-Inch Thick Tailgate Glass.	9-07	79-59
Hood Release Handle Binding or Inoperative — 1979 Wagoneer, Cherokee and Truck Models Built Prior to VIN J9A15NN060233.	9-06	79-60
Wagoneer Limited, Front Fender Woodgrain Moulding Retention — 1978-79 Wagoneer Models With Limited Trim Option.	9-05	79-62
Tailgate Window Overtravel — 1979 Wagoneer and Cherokee Models Built Prior to J9XXXXX056283.	9-04	79-63
Windshield Cracking During Extreme Cold Weather — 1978-79 CJ Models Built Prior to J9XXXXH035319 (Toledo) and J9XXXXH804015 (Brampton).	9-03	79-64
Door Lock and Latch Mechanism Freeze-Up — All 1978-79 Cherokee, Wagoneer and Truck Models.	9-02	79-65
1979 Wagoneer, Cherokee, and Truck Plastic Radiator Grille — Early Built 1979 Wagoneer, Cherokee, and Truck Models.	9-01	79-67
Improved Door Rain Shield Rivet — 1979 and Prior Cherokee, Wagoneer and Truck Models - Service Technical Letter - Refer to Service General.	9-11	79-88
New Latch and Striker Assembly — 1979 Cherokee-Wagoneer-Truck Doors and 1979 Cherokee-Wagoneer Tailgates - Service Technical Letter - Refer to Service General.	9-07	79-92
Frozen Door Handle Pushbutton Repair — 1978-79 Cherokee, Wagoneer, and Truck Models - Service Technical Letter - Refer to Service General.	9-06	79-93
Bronze Tone Tint Damage — CJ-7 Golden Eagle - Service Technical Letter - Refer to Service General.	9-06	79-93
Roof Rack Moan — 1979 Wagoneer and Cherokee Models - Service Technical Letter - Refer to Service General.	9-05	79-94

## 1979 BODY ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
Oil Pressure Gauge Needle Flutters during Engine Operation on some 1979-82 CJ and Scrambler Models.	8-05-82	79-68
Moisture Entering Parking and Front Directional Signal Lamp Assembly — 1976-80 CJ Models.	80-2	79-69
Tailgate Glass Defogger Wire Repair — 1977-79 Wagoneer and Cherokee With Tailgate Glass Repair.	9-01	79-70
Antenna Splitter Box Relocation — 1979 Cherokee, Wagoneer, and Truck Models With CB Radio - Service Technical Letter - Refer to Service General.	9-08	79-91

## 1979 HEATER-AIR CONDITIONING

Subject (Problem and Application)	Bulletin Number	Page
Air Control Cable Operation — 1978-81 CJ-5 and CJ-7 Models.	81-1	79-72
Heater Diagnosis and Repair — All 1978-79 Jeep Vehicles.	9-01	79-73

## 1979 INSTRUMENT PANELS-SEAT ASSEMBLIES

Subject (Problem and Application)	Bulletin Number	Page
Replacement of Watershield Paper — 1977-79 Cherokee-Wagoneer-Truck Models - Service Technical Letter - Refer to Service General.	9-10	78-89
Early Built 1979 Cherokee and Wagoneer Models Equipped With a Bench-Style (One-Piece) Front Seat - Service Technical Letter - Refer to Service General.	9-01	79-99

## 1979 HEADLINING-HARDTOP-ENCLOSURE-EXTERIOR DECALS AND OVERLAYS

Subject (Problem and Application)	Bulletin Number	Page
Sun Roof Arm Operator — 1979-80 CJ-7 Hardtop Models with Type I Sun Roof.	80-2	79-75

## 1979 METAL REPAIR-PAINTING-WATER LEAKS/WIND NOISE

Subject (Problem and Application)	Bulletin Number	Page
1979 Phase-Out/1980 Phase-In Program Paint Information — 1979 Jeep Vehicles.	9-04	79-76
1979 Silver Anniversary CJ-5 Model Paint Information — 1979 CJ-5 Model.	9-03	79-79
Wind Noise or Water Leaks at Door Glass — 1979 Wagoneer, Cherokee and Truck Models.	9-02	79-80
Paint Information — All 1979 Jeep Vehicles.	9-01	79-81

## 1979 SERVICE GENERAL

Subject (Problem and Application)	Bulletin Number	Page
Standard Oil Filter Damaged During Severe Off-Road Operation — 1974-80 Jeep Cherokee-Wagoneer-Truck Models with Six-Cylinder Engine.	80-18	79-82
Two-Stage Power Valve — Models 2100 and 2150 — 1978-80 Jeep Vehicles.	80-16	79-83
Camshaft Spring Pin Correction — Six-Cylinder Camshaft Pin Breakage on 1977-80 Jeep Vehicles - DRB 80-3, dated February 4, 1980, filed Under Power Plant - Engines.	80-7	79-84

## 1979 SERVICE GENERAL (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Difficult Starting after Parking Overnight — Expanded Application of DRB 9-03, Power Plant, Fuel and Exhaust Systems.	80-5	79-85
New Exhaust Manifold Gasket — Eight-Cylinder Engines.	9-13	79-86
1979 CJ Model Revised Clutch Linkage Components	9-12	79-87
Improved Door Rain Shield Rivet — 1979 and Prior Cherokee, Wagoneer, and Truck Models.	9-11	79-88
1979 Jeep Warm Engine Operation Bulletins.	9-11	79-88
Replacement of Watershield Paper — 1977-79 Cherokee - Wagoneer - Truck Models.	9-10	79-89
1979 Jeep Models — Severe Engine Spark Knock While Trailer Towing or During Heavy Load Operation.	9-09	79-90
Antenna Splitter Box Relocation — 1979 Cherokee, Wagoneer, and Truck Models With C.B. Radio.	9-08	79-91
New Latch and Striker Assembly — 1979 Cherokee - Wagoneer Tailgates.	9-07	79-92
Frozen Door Handle Pushbutton Repair — 1978-79 Cherokee, Wagoneer, and Truck Models.	9-06	79-93
Bronze Tone Tint Damage — CJ-7 Golden Eagle.	9-06	79-93
Tire Size Capacity of Swing-Out Spare Tire Carrier — 1976-79 CJ-5 and CJ-7 Models.	9-06	79-93
Compression Pressure Specifications Update — 1977-79 Six- and Eight-Cylinder Engines.	9-05	79-94
Roof Rack Moan — 1979 Wagoneer and Cherokee Models.	9-05	79-94
Forward Clutch Piston Center Seal — All Jeep Models With Hydramatic Transmission.	9-04	79-95
Engine Operation.	9-04	79-95
Dashpot Adjustment — Addition to 1979 Jeep Technical Service Manual.	9-04	79-95
Automatic Transmission Clutch and Band Application Chart.	9-03	79-96
Service Technical Letter No. 9-02 dated October 2, 1978 — All 1979 Jeep Models - Starter Solenoid With Blade Terminals.	9-03	79-96
Service Technical Letter Number 8-07, dated September 28, 1978.	9-02	79-97
All 1979 Jeep Models Equipped With Quadra-Trac Transmission-to-Quadra-Trac O-Ring Seal.	9-02	79-97
All 1979 Jeep Models — Starter Solenoid With Blade Terminals.	9-02	79-98
1978 Jeep Owners' Manual Supplement.	9-02	79-98
1979 Jeep Technical Service Manual Correction.	9-02	79-98
Early Built 1979 Cherokee and Wagoneer Models Equipped With a Bench-Style (One-Piece) Front Seat.	9-01	79-99
1979, 360 CID V-8 Engine — Cold Engine Spark Knock.	9-01	79-99

## 1978 ENGINE

Subject (Problem and Application)	Bulletin Number	Page
Camshaft Spring Pin Correction — Six-Cylinder Camshaft Pin Breakage on 1977-80 Jeep Vehicles - DRB 80-3 dated February 4, 1980, filed under Power Plant - Engines.	80-7	80-109
Six-Cylinder Camshaft Pin Breakage — 1977-80 Jeep Vehicles with Six-Cylinder Engine.	80-3	78-1

## 1978 ENGINE (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Oil Leakage At Cylinder Head Cover or Oil Pan Gasket Surface — All 1976-1978 Jeep Models.	8-03	78-3
V-8 Engine Oil Pressure - New Oil Pressure Relief Spring — 1977-1978 V-8 Engines In Vehicles With Oil Pressure Gauges.	8-02	78-5
V-8 Engine Oil Consumption - Intake Manifold Gasket — All 1978 V-8 Engines.	8-01	78-6
Standard Oil Filter Damaged during Severe Off-Road Operation — 1974-80 Jeep Cherokee, Wagoneer-Truck Models with Six-Cylinder Engine - Service Technical Letter - Refer to Service General.	80-18	80-98
Camshaft Spring Pin Correction — Six-Cylinder Camshaft Pin Breakage on 1977-80 Jeep Vehicles - DRB-80-3 dated February 4, 1980, Filed under Power-Plant Engine - Service Technical Letter - Refer to Service General.	80-7	80-109
Compression Pressure Specification Update - 1977-79 Six- and Eight-Cylinder Engines - Service Technical Letter - Refer to Service General.	9-05	78-102
Engine Oil Filters - All CJ Models Equipped With Six-Cylinder Engines - Service Technical Letter - Refer to Service General.	8-05	78-107
Rocker Arm Pivot Hole Off Center - 1978 Models With V-8 Engine - Service Technical Letter - Refer to Service General.	8-01	78-112
Valve Train Noise - V-8 Engines - Service Technical Letter - Refer to Service General.	8-01	78-106

## 1978 COOLING SYSTEM

Subject (Problem and Application)	Bulletin Number	Page
Radiator Coolant Overflow — 1978 Cherokee, Wagoneer and Truck Models With Air Conditioning or Heavy Duty Cooling.	8-01	78-7
Correct Tempatrol Fan Assembly Storage — 1980 and Prior Jeep Models - Service Technical Letter - Refer to Service General.	80-3	80-113

## 1978 ENGINE ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
New Voltage Regulator Tester — 1975-81 Jeep Vehicles.	81-1	79-4
Ammeter Circuit and Wiring Diagram Revisions — 1978-1979 Wagoneer, Cherokee, and Truck Models.	9-02	78-8
Two-Stage Power Valve — Carburetor Models 2100 and 2150 — 1978-80 Jeep Vehicles - Service Technical Letter - Refer to Service General.	80-16	79-83
Batteries in CJ Models Built After May 16, 1978 - Service Technical Letter - Refer to Service General.	8-05	78-106
Battery Post Contamination — All Models - Service Technical Letter - Refer to Service General.	8-02	78-111

## 1978 FUEL AND EXHAUST SYSTEMS

Subject (Problem and Application)	Bulletin Number	Page
Altitude Performance Adjustments — 1968-80 Jeep Vehicles.	80-7	78-9
BASCENS Campaign (Type "E" Product Recall Campaign): Exhaust Gas Recirculation (EGR) Back Pressure Sensor Replacement and Adjustment of Idle Mixture Setting (Lean Idle Drop Specification Change to 50 RPM for All Six-Cylinder Engines) — 1974-79 Jeep Vehicles.	8-09	79-14

## 1978 FUEL AND EXHAUST SYSTEMS (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Rough or High Engine Idle Speed or Dieseling When Warm Engine Is Shut Off — 1976-78 Cherokee, Wagoneer, or Truck Models Equipped With 360 or 401 CID Engine and 4V Carburetor.	8-08	78-10
Left Rear Quarter Panel Rattle — 1978-79 Wagoneer and Cherokee Models.	9-04	78-12
Emission Components — All 1976-1978 Jeep Models.	8-07	78-13
Gas Tank Sending Unit — 1975-1978 Cherokee and Wagoneer.	8-06	78-18
Inability to Obtain W.O.T. or Actuate the Choke Unloader — 1978 Wagoneer, Cherokee and Truck.	8-05	78-20
Cold, Hard Starting — 1978 Cherokee and Truck Models With 258 CID Engine and 2V Carburetor.	8-04	78-22
California Emission, Carburetion and Tune-up Specifications - Addition To Volume 1 of the 1978 Technical Service Manual — 1978 California Wagoneer, Cherokee and Truck Models With 360 CID Engine, 2V Carburetor and Automatic Transmission.	8-03	78-24
J-SPRING (Type S Product Recall Campaign): Addition of Another Accelerator Return Spring — 1978 Jeep Cherokee and Truck Models With 258 CID Engine and 2V Carburetor Built Between J8XXXXC00008 and J8XXXXC037866.	8-02	78-26
Possible Hesitation or Stumble on Initial Acceleration — 1978 Wagoneer, Cherokee and Truck Models With 360 CID, V-8 Engine and 2V Carburetor (Except California).	8-01	78-28
1978 Model BBD - 2V Carburetor - Accelerator Pump Change - Service Technical Letter - Refer to Service General.	8-06	78-105
1978, Six-Cylinder Engine Exhaust Manifold - Two Center Lower Attaching Holes May Not Line Up With Cylinder Head Holes - Service Technical Letter - Refer to Service General.	8-05	78-106
1978 Jeep Technical Service Manual, Volume 1 Correction - Model 2100 - 2V Carburetor - Service Technical Letter - Refer to Service General.	8-05	78-107
Color Coded Spark Plugs - Service Technical Letter - Refer to Service General.	8-04	78-108
Spark Plug Fuel Fouling at Low Mileage - New Vehicles - Service Technical Letter - Refer to Service General.	8-03	78-109

## 1978 CLUTCH-MANUAL TRANSMISSION

Subject (Problem and Application)	Bulletin Number	Page
Improved Procedures for Clutch Overcenter Spring and Clutch Pedal Replacement — 1977-79 CJ Models.	9-02	78-29
Model T-150, Three-Speed Manual Transmission With Interflow Lubrication System — 1978 CJ Models Built After VIN J8FXXXX097193.	8-03	78-31
TRANLUB Campaign (Type "S" Product Recall Campaign): Three-Speed Transmission Adapter Plate Seal May Be Improperly Seated — 1976, 1977 and 1978 CJ-5, CJ-6 and CJ-7.	8-02	78-33
Manual Transmission Model T-15A Shift Control Housing Technical Service Manual Correction — 1973-1978 Jeep Technical Service Manual.	8-01	78-37

## 1978 AUTOMATIC TRANSMISSION

Subject (Problem and Application)	Bulletin Number	Page
Fluid Overflow From Automatic Transmission Fill Tube or Vent Tube Caused by Overfill or Vent Tube Restriction — 1977-79 Jeep Models With Automatic Transmission.	9-02	78-38
Premature Part Throttle Kickdown — 1978 Wagoneer and Cherokee Models With V-8 Engine and Automatic Transmission.	8-04 Revised	78-39



## 1978 AUTOMATIC TRANSMISSION (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Automatic Transmission Vacuum Modulator Testing Procedure — All 1974-1978 Jeep Models With Automatic Transmission.	8-03	78-41
Gear Shift Knob Replacement — 1976-1978 Jeep Models With Automatic Transmission.	8-02	78-42
Transmission Hunting — 1978 Wagoneer, Cherokee and Truck Models With 360 CID, V-8 and 2V Carburetor (Except California).	8-01	78-43
Automatic Transmission Clutch and Band Application Chart - Service Technical Letter - Refer to Service General.	9-03	79-96
Typographical Error — 1977 Technical Service Manual, Page 7-50 and 1978 Technical Service Manual, Page 2C-53 - Service Technical Letter - Refer to Service General.	8-02	78-111

## 1978 TRANSFER CASE/QUADRA-TRAC

Subject (Problem and Application)	Bulletin Number	Page
Improved Stick-Slip Correction Procedure 1973-79 Jeep Vehicles With Quadra-Trac Transfer Case.	9-01	78-44
Quadra-Trac With Reduction Unit - Disengages From High Range — 1977-78 Jeep Vehicles With Quadra-Trac and Reduction Unit.	8-01	78-46
1978 Jeep Technical Service Manual Revision - Transfer Case - Service Technical Letter - Refer to Service General.	8-03	78-109
Quadra-Trac Front Output Shaft Spline Change - Service Technical Letter - Refer to Service General.	8-03	78-110
Quadra-Trac Use When Plowing Snow - Service Technical Letter - Refer to Service General.	8-03	78-109

## 1978 AXLES-PROPELLER SHAFT

Subject (Problem and Application)	Bulletin Number	Page
Rear Axle Housing Cover Service — 1977-79 CJ Models.	9-02	78-48
Revised Ball Stud Preload Correction and Front Wheel Shimmy Procedures — All 1978-79 Jeep Models.	9-01	78-49
Driveline Noise or Vibration — 1978 Jeep CJ Models Equipped With Warn Selective Drive Hubs (M-245) (SE2063019) and (M-243) (SE2063021).	8-02	78-50
Lubrication - Double Cardan Universal Joint — 1976-1978 Models (Except CJ Models With Manual Transmission).	8-01	78-51

## 1978 BRAKES-WHEELS-TIRES

Subject (Problem and Application)	Bulletin Number	Page
Disc Brake Caliper Pistons in some 1976-82 Jeep Vehicles May Develop a Light Coating of Rust on the Surface under the Dust Seal Outboard of the Piston Seal.	3-02-82	82-45
Disc Brake Noise — 1978-80 Cherokee, Wagoneer and Truck Models.	80-1	80-51
Brake Drum and Rotor Repair vs. Replacement — All 1976-79 Jeep Vehicles.	9-01	78-52
Brake Master Cylinder Push Rod Retainer — 1977-1978 CJ Models With Manual Disc Brakes - Service Technical Letter - Refer to Service General.	8-05	78-106

## 1978 STEERING AND SUSPENSION

Subject (Problem and Application)	Bulletin Number	Page
Power Steering Gear Repair vs. Replacement — All 1977-79 Jeep Vehicles Equipped With Power Steering.	9-01	78-56
Rivnut Replacement — 1977-1978 CJ Models Equipped With Front Stabilizer Bar.	8-03	78-58
Sport Steering Wheel Replacement — 1977-1978 Jeep Vehicles Equipped With Sport Wheel.	8-02	78-60
CJPOT (Type S Product Recall Campaign): Steering Gear Intermediate Shaft Coupling May Have Oversized Serrations — 1978 CJ-5 and CJ-7 Models With Manual Steering.	8-01	78-61
Power Steering Gear Diagnosis — Service Technical Letter - Refer to Service General.	8-06	78-105

## 1978 BODY GENERAL

Subject (Problem and Application)	Bulletin Number	Page
Wagoneer Limited, Front Fender Woodgrain Moulding Retention — 1978-79 Wagoneer Models With Limited Trim Option.	9-05	78-64
Windshield Cracking During Extreme Cold Weather — 1978-79 CJ Models Built Prior to J9XXXXH035319 (Toledo) and J9XXXXH804015 (Brampton).	9-03	78-65
Door Lock and Latch Mechanism Freeze-Up — All 1978-79 Cherokee, Wagoneer and Truck Models.	9-02	78-66
Wagoneer Limited Trim Package — 1978 Wagoneer Models.	8-02	78-68
Transmission Shift Cover Contacting Floor-pan — 1976, 1977 and 1978 Cherokee and Truck Models With 4-Speed Transmission.	8-01	78-70
Frozen Door Handle Pushbutton Repair - 1978-79 Cherokee, Wagoneer, and Truck Models - Service Technical Letter - Refer to Service General.	9-06	78-101
1978 Jeep Owner's Manual Supplement - Service Technical Letter - Refer to Service General.	9-02	78-104
Canvas Top Installation — CJ-7 Models Which Previously Had a Factory Installed Hardtop and Rollbar - Service Technical Letter - Refer to Service General.	8-05	78-106
1978 Wagoneer Rear Window Reveal Moulding - Service Technical Letter - Refer to Service General.	8-04	78-108

## 1978 BODY ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
Moisture Entering Parking and Front Directional Signal Lamp Assembly — 1976-80 CJ Models.	80-2	78-71
Tailgate Glass Defogger Wire Repair — 1977-79 Wagoneer and Cherokee With Tailgate Glass Repair.	9-01	78-72
Electric Tailgate Regulator and Motor Change — 1978 Wagoneer and Cherokee Models With Electrically Operated Tailgate Window.	8-07	78-74
Windshield Wiper Motor Disassembly and Assembly Procedure Supplementary Technical Service Manual Information — 1974, 1975, 1976, 1977 and 1978 Jeep Wagoneer, Cherokee and Truck Models.	8-06	78-76
CB Radio Antenna and Splitterbox Adjustment Procedure — All 1978 Jeep Models With CB Radio.	8-05	78-78
Electric Tailgate Window Regulator Pinion Gear Shaft Loose — 1974, 1975, 1976, 1977, and 1978 Wagoneer and Cherokee Models With Electric Tailgate Window.	8-04	78-80
Broken Electrical Connector — Tailgate Window Motor 1974, 1975, 1976, 1977 and 1978 Wagoneer and Cherokee Models With Electrically Operated Tailgate Window.	8-03	78-82

## 1978 BODY ELECTRICAL (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
CB Radio Antenna and Splitterbox Adjustment Procedure — 1978 Wagoneer, Cherokee, and Truck Models With CB Radio.	8-02	78-84
Cracked Headlamp Bulb — 1977 and 1978 CJ-5 and CJ-7 Models Built Between VINs J7XXXXX108715 and J8XXXXX013665.	8-01	78-86

## 1978 HEATER-AIR CONDITIONING

Subject (Problem and Application)	Bulletin Number	Page
Air Control Cable Operation — 1978-81 CJ-5 and CJ-7 Models.	81-1	78-87
Heater Diagnosis and Repair — All 1978-79 Jeep Vehicles.	9-01	78-88
Heater Core Repair — 1978 Wagoneer, Cherokee, and Truck Models.	8-02	78-90
Heater Noise (Moan) — 1978 CJ-5 and CJ-7 Models With V-8 Engine.	8-01	78-92

## 1978 INSTRUMENT PANEL — SEAT ASSEMBLIES

Subject (Problem and Application)	Bulletin Number	Page
Seat Cover Button Replacement — 1977-1978 Jeep Models With Seat Cover Buttons.	8-01	78-93
Replacement of Watershield Paper — 1977-79 Cherokee-Wagoneer-Truck Models - Service Technical Letter - Refer to Service General.	9-10	78-100

## 1978 METAL REPAIR-PAINTING-WATER LEAKS/WIND NOISE

Subject (Problem and Application)	Bulletin Number	Page
Paint Information Phase-Out/7900 Phase-In Program Supplement — 7800 Jeep Vehicles.	8-02	78-95
Paint Information 7800 Phase-Out/7900 Phase-In Program — 7800 Jeep Vehicles.	8-01	78-96

## 1978 SERVICE GENERAL

Subject (Problem and Application)	Bulletin Number	Page
Replacement of Watershield Paper — 1977-79 Cherokee - Wagoneer - Truck Models.	9-10	78-100
Frozen Door Handle Pushbutton Repair — 1978-79 Cherokee, Wagoneer, and Truck Models.	9-06	78-101
Tire Size Capacity of Swing-Out Spare Tire Carrier — 1976-79 CJ-5 and CJ-7 Models.	9-06	78-101
Compression Pressure Specifications Update — 1977-79 Six and Eight-Cylinder Engines.	9-05	78-102
1978 Jeep Owners' Manual Supplement.	9-02	78-104
Power Steering Gear Diagnosis.	8-06	78-105
1978 Model BBD-2V Carburetor — Accelerator Pump Change.	8-06	78-105
1979 CJ-7 Models Equipped With Soft Top.	8-06	78-105
Canvas Top Installation — CJ-7 Models Which Previously Had a Factory Installed Hardtop and Roll Bar.	8-05	78-106
Brake Master Cylinder Push Rod Retainer — 1977-78 CJ Models With Manual Disc Brakes.	8-05	78-106
Batteries In CJ Models Built After May 16, 1978.	8-05	78-106

## 1978 SERVICE GENERAL (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Valve Train Noise — V-8 Engines.	8-05	78-106
Engine Oil Filters — All CJ Models Equipped With Six-Cylinder Engine.	8-05	78-107
1978 Jeep Technical Service Manual, Volume I Correction — Model 2100 2V Carburetor.	8-05	78-107
1978 6-Cylinder Engine Exhaust Manifold — Two Center Lower Attaching Holes May Not Line Up With Cylinder Head Holes.	8-05	78-107
1978 Wagoneer Rear Window Reveal Moulding	8-04	78-108
Color Coded Spark Plugs	8-04	78-108
Spark Plug Fuel Fouling at Low Mileage — New Vehicles.	8-03	78-109
1978 Jeep Technical Service Manual Revision — Transfer Case.	8-03	78-109
Quadra-Trac Use When Plowing Snow.	8-03	78-109
Quadra-Trac Front Output Shaft Spline Change.	8-03	78-110
Typographical Error — 1977 Technical Service Manual, Page 7-50 and 1978 Technical Service Manual, Page 2C-53.	8-02	78-111
Battery Post Contamination — All Models.	8-02	78-111
Correction of Rear Wheel Cylinder Diameter — 1976 Technical Service Manual, Page 9-41 and 1977 Technical Service Manual, Page 9-47.	8-02	78-111
Rocker Arm Pivot Hole Off Center — 1978 Models With V-8 Engines.	8-01	78-112

## 1977 ENGINE

Subject (Problem and Application)	Bulletin Number	Page
Camshaft Spring Pin Correction — Six-Cylinder Camshaft Pin Breakage on 1977-80 Jeep Vehicles - DRB 80-3 dated February 4, 1980, filed under Power Plant - Engines.	80-7	80-109
Six-Cylinder Camshaft Pin Breakage — 1977-80 Jeep Vehicles with Six-Cylinder Engine.	80-3	77-1
Oil Leakage At Cylinder Head Cover or Oil Pan Gasket Surface — All 1976-1978 Jeep Models.	8-03	77-3
V-8 Engine Oil Pressure - New Oil Pressure Relief Spring — 1977-1978 V-8 Engines In Vehicles With Oil Pressure Gauges.	8-02	78-5
Oil Filter May Contact Right Front Engine Support Cushion During Severe Off-Road Operation — 1976 and 1977 CJ Models With Six-Cylinder Engine Built Prior to VIN J7XXXXX024954.	7-02	77-5
Connecting Rod Bearing Noise — Early 1977 Models With Six-Cylinder Engine.	7-01	77-7
Standard Oil Filter Damaged During Severe Off-Road Operation 1974-80 Jeep Cherokee, Wagoneer-Truck Models With Six-Cylinder Engine - Service Technical Letter - Refer to Service General.	80-18	80-98
Camshaft Spring Pin Correction — Six-Cylinder Camshaft Pin Breakage on 1977-80 Jeep Vehicles. DRB 80-3 Dated February 4, 1980. Filed Under Power Plant - Engine-Service Technical Letter - Refer to Service General.	80-7	80-109
Compression Pressure Specification Update - 1977-79 Six- and Eight-Cylinder Engines - Service Technical Letter - Refer to Service General.	9-05	77-111
Crankshaft Pilot Bushing - All Models - Service Technical Letter - Refer to Service General.	7-07	77-118

## 1977 COOLING SYSTEM

Subject (Problem and Application)	Bulletin Number	Page
Possible Coolant Leak Due to Punctured Bottom Radiator Tank - Caused by Radiator Being Positioned Too Low — 1977 Wagoneer and Cherokee Models With V-8 Engine and Power Steering - Built Prior to VIN J7XXXXX058859.	7-01	77-9
Engine Overheating — 1976-77 CJ-5, CJ-7, Cherokee and Truck Models With Six-Cylinder Engine - Built Prior to J7XXXXX002807.	TB-1	77-11
Correct Tempatrol Fan Assembly Storage — 1980 and Prior Jeep Models - Service Technical Letter - Refer to Service General.	80-3	80-113
Cooling System Thermostat Revision - Service Technical Letter - Refer to Service General.	7-04	77-122

## 1977 ENGINE ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
New Voltage Regulator Tester — 1975-81 Jeep Vehicles.	81-1	81-12
BID Distributor Kit — 1975, 1976 and 1977 Models With BID Ignition System.	7-05	77-13
Off-Road Driving Lamp Kit - Installation and Aiming Procedures — 1977 J-10 Truck Models With Golden Eagle Trim Package.	7-04	77-17
Distributor Sensor Wiring Routing — All 1977 Models.	7-03	77-20
Engine Continues to Run After Ignition Switch is Turned Off- Caused by Alternator Feedback — 1976 and 1977 CJ Models With Six-Cylinder Engine and Delco Alternator Built Prior to VIN J7XXXXX038559.	7-02	77-21
Distributor Cap Holddown Clip Replacement 1975, 1976 and 1977 — All Models.	7-01	77-22
Battery Post Contamination - All Models Service Technical Letter - Refer to Service General.	8-02	77-115
Cruise Command Control Regulators — All 1977 Models With Cruise Command - Service Technical Letter - Refer to Service General.	7-07	77-118
Improved Design Batteries — All 1977 Models - Service Technical Letter - Refer to Service General.	7-02	77-124
Revised Procedure for Storage and Protection of New Vehicle — All 1977 Models - Service Technical Letter - Refer to Service General.	7-02	77-124

## 1977 FUEL AND EXHAUST SYSTEMS

Subject (Problem and Application)	Bulletin Number	Page
Altitude Performance Adjustments — 1968-80 Jeep Vehicles.	80-7	77-23
BASCENS Campaign (Type E Product Recall Campaign): Exhaust Gas Recirculation (EGR) Back Pressure Sensor Replacement and Adjustment of Idle Mixture Setting (Lean Idle Drop Specification Change to 50 RPM for all Six-Cylinder Engines) - 1974-79 Jeep Vehicles.	TB-02	77-24
Rough or High Engine Idle Speed or Dieselling When Warm Engine is Shut Off — 1976-78 Cherokee, Wagoneer, or Truck Models Equipped With 360 or 401 CID Engine and 4V Carburetor.	8-08	77-28
Gas Tank Sending Unit — 1975-1978 Cherokee and Wagoneer	8-06	77-30
Emission Components — All 1976-1978 Jeep Models.	8-07	77-32
Slow Fuel Fill — 1974, 1975, 1976 and 1977 Wagoneer and Cherokee Models.	7-01	77-37
Front Exhaust Pipe-to-Exhaust Manifold Attaching Nuts - All 1977 Models - Service Technical Letter - Refer to Service General.	7-07	77-119

## 1977 CLUTCH-MANUAL TRANSMISSION

Subject (Problem and Application)	Bulletin Number	Page
Improved Procedures for Clutch Overcenter Spring and Clutch Pedal Replacement 1977-79 CJ Models.	9-02	77-40
TRANLUB Campaign (Type "S" Product Recall Campaign): Three-Speed Transmission Adapter Plate Seal May Be Improperly Seated — 1976, 1977 and 1978 CJ-5, CJ-6 and CJ-7.	8-02	77-42
Manual Transmission Model T-15A Shift Control Housing Technical Service Manual Correction — 1973-1978 Jeep Technical Service Manual.	8-01	77-46
Possible Gear Clash in Second and Third Gear - Caused by Worn Inserts in Synchronizer — 1977 CJ Models With T-150 Transmission - Built Between VINs J7XXXXX106233 and J7XXXXX109229 - Service Technical Letter - Refer to Service General.	7-08	77-116

## 1977 AUTOMATIC TRANSMISSION

Subject (Problem and Application)	Bulletin Number	Page
Fluid Overflow From Automatic Transmission Fill Tube or Vent Tube Caused by Overfill or Vent Tube Restriction — 1977-79 Jeep Models With Automatic Transmission.	9-02	77-47
Automatic Transmission Vacuum Modulator Testing Procedure — All 1974-1978 Jeep Models With Automatic Transmission.	8-03	77-48
Gear Shift Knob Replacement — 1976-1978 Jeep Models With Automatic Transmission.	8-02	77-49
Improved Forward Clutch Apply Piston Center Seal — All 1977 Models With Automatic Transmission.	7-01	77-50
Automatic Transmission Clutch and Band Application Chart - Service Technical Letter - Refer to Service General.	9-03	77-112
Typographical Error — 1977 Technical Service Manual, Page 7-50 and 1978 Technical Service Manual, Page 2C-53 - Service Technical Letter - Refer to Service General.	8-02	77-115
Automatic Transmission - Manual Shaft Hex Nut — Early 1977 Models With Automatic Transmission - Service Technical Letter - Refer to Service General.	77-01	77-126

## 1977 TRANSFER CASE/QUADRA-TRAC

Subject (Problem and Application)	Bulletin Number	Page
Improved Stick-Slip Correction Procedure 1973-79 Jeep Vehicles With Quadra-Trac Transfer Case.	9-01	77-51
Quadra-Trac With Reduction Unit - Disengages From High Range — 1977-1978 Jeep Vehicles With Quadra-Trac and Reduction Unit.	8-01	77-53
Quadra-Trac Drive Chain Replacement — 1973 Through 1977 Wagoneer, Cherokee and Truck Models and 1976 and 1977 CJ-7 Models With Quadra-Trac Transfer Case.	7-01	77-55
Automatic Transmission-to-Quadra-Trac Installation — All Models With Automatic Transmission and Quadra-Trac - Service Technical Letter - Refer to Service General.	7-08	77-116
Quadra-Trac Front Cover-to-Case Gasket — All Models With Quadra-Trac - Service Technical Letter - Refer to Service General.	7-08	77-117
Quadra-Trac Chain Tension Measurement - Service Technical Letter - Refer to Service General.	7-05	77-121

## 1977 AXLES-PROPELLER SHAFTS

Subject (Problem and Application)	Bulletin Number	Page
Rear Axle Housing Service — 1977-79 CJ Models	9-02	77-56
Lubrication - Double Cardan Universal Joint — 1976-1978 Models (Except CJ Models With Manual Transmission).	8-01	77-57
Front Propeller Shaft May Contact Starter Motor During Severe Off-Road Operation — 1977 Cherokee and Truck Models With Six-Cylinder Engine and Cherokee, Wagoneer and Truck Models With V-8 Engine.	7-01	77-58
Front Axle Application — 1976-77 Cherokee and J10 Truck Models.	TB-1	77-60
Wheel Lug Studs Off Center in Rear Axle Shaft Flange — 1976 and 1977 Wagoneer Cherokee, and Truck Models - Service Technical Letter - Refer to Service General.	7-05	77-121
Relubable Propeller Shaft Slipjoints and Spiders — 1977 CJ Models - Service Technical Letter - Refer to Service General.	7-04	77-122
Warn Lock-O-Matic Hub Installation — 1977 Cherokee and J-10 Truck Models Built Between VINs J7XXXXX021438 and J7XXXXX031794 - Service Technical Letter - Refer to Service General.	7-02	77-124
Rear Axle Application — Early 1977 Cherokee, Wagoneer and Truck Models - Service Technical Letter - Refer to Service General.	77-01	77-126

## 1977 BRAKES-WHEELS-TIRES

Subject (Problem and Application)	Bulletin Number	Page
Disc Brake Caliper Pistons in some 1976-82 Jeep Vehicles May Develop a Light Coating of Rust on the Surface under the Dust Seal Outboard of the Piston Seal.	3-02-82	82-45
Brake Drum and Rotor Repair vs. Replacement — All 1976-79 Jeep Vehicles.	9-01	77-61
Possible Brake Drag - Caused by Brake Pedal Not Returning Fully When Released — 1976 and 1977 CJ Models Equipped With Manual Drum Brakes and Manual Transmission Built Prior to VIN J7XXXXX042579.	7-01	77-65
Brake Master Cylinder Push Rod Retainer — 1977-1978 CJ Models With Manual Disc Brakes - Service Technical Letter - Refer to Service General.	8-05	77-113
Correction of Rear Wheel Cylinder Diameter — 1976 Technical Service Manual, Page 9-41 and 1977 Technical Service Manual, Page 9-47 - Service Technical Letter - Refer to Service General.	8-02	77-115

## 1977 STEERING AND SUSPENSION

Subject (Problem and Application)	Bulletin Number	Page
Power Steering Gear Repair vs. Replacement — All 1977-79 Jeep Vehicles Equipped With Power Steering.	9-01	77-66
Rivnut Replacement — 1977-78 CJ Models Equipped with Front Stabilizer Bar.	8-03	77-68
Sport Steering Wheel Skirt Replacement 1977-78 Jeep Vehicles Equipped With Sport Steering Wheel.	8-02	77-70
Momentary Delay in Power Steering Assist During Cold Start-Up — All 1975, 1976 and 1977 Models With Power Steering.	7-01	77-71
Vibrations - Mechanical and Audible — All Jeep Vehicles - Service Technical Letter - Refer to Service General.	7-07	77-118

## 1977 BODY GENERAL

Subject (Problem and Application)	Bulletin Number	Page
Transmission Shift Cover Contacting Floor-pan — 1976, 1977, and 1978 Cherokee and Truck Models With 4-Speed Transmission.	8-01	77-72
Body-to-Rear Wheelhouse Strainer Pulled Loose — 1976 and 1977 CJ Models With Hardtop Enclosure.	7-06	77-73
Water Leak Around Liftgate Hinges - Caused By Loose Hinges — 1977 CJ-7 Models With Hardtop Enclosure Built Prior to VIN J7XXXXX053859.	7-05	77-74
Seized or Binding Windshield, Door, or Tailgate Hinges - Caused by Rust or Corrosion — 1976 and 1977 CJ-5 and CJ-7 Models Built Prior to VIN J7XXXXX014510.	TB-2	77-75
Jeep Vehicles With Snow Plow/Winch Overheating at Highway Speeds — 1977 Models Service Technical Letter - Refer to Service General.	7-02	77-125

## 1977 BODY ELECTRICAL

Subject (Problem and Application)	Bulletin Number	Page
Moisture Entering Parking and Front Directional Signal Lamp Assembly — 1976-80 CJ Models.	80-2	77-77
Tailgate Glass Defogger Wire Repair — 1977-79 Wagoneer and Cherokee With Tailgate Glass Repair.	9-01	77-78
Windshield Wiper Motor Disassembly and Assembly Procedure Supplementary Technical Service Manual Information — 1974, 1975, 1976, 1977, 1978 Jeep Wagoneer, Cherokee, and Truck Models.	8-06	77-80
Electric Tailgate Window Regulator Pinion Gear Shaft Loose.	8-04	77-82
Broken Electrical Connector — Tailgate Window Motor — 1974-78 Wagoneer and Cherokee Models with Electrically Operated Tailgate Window.	8-03	77-84
Cracked Headlamp Bulb — 1977 and 1978 CJ-5 and CJ-7 Models Built Between VINs J6XXXXX108715 and J8XXXXX013665.	8-01	77-86
Off-Road Driving Lamp Kit - Installation and Aiming Procedures — 1977 J-10 Truck Models With Golden Eagle Trim Package.	7-04	77-87
Citizens Band (CB) Mobile Radio and Antenna Diagnosis Procedure — 1976 and 1977 Models.	7-01	77-90
Replacement of Off-Road Driving Lamp Kit — 1977 J-10 Truck Models With Golden Eagle Trim Package - Service Technical Letter - Refer to Service General.	7-08	77-116

## 1977 HEATER-AIR CONDITIONING

Subject (Problem and Application)	Bulletin Number	Page
Air Conditioning System Not Cooling Caused by Obstruction in Suction Hose — Late 1976 Models and Early 1977 Models Built Prior to VIN J7XXXXX015089 Equipped With Air Conditioning.	TB-1	77-94

## 1977 INSTRUMENT PANELS-SEAT ASSEMBLIES

Subject (Problem and Application)	Bulletin Number	Page
Seat Cover Button Replacement - 1977-1978 Jeep Models With Seat Cover Buttons.	8-01	77-95
Replacement of Watershield Paper — 1977-79 Cherokee-Wagoneer-Truck Models - Service Technical Letter - Refer to Service General.	9-10	77-109
Rear Seat Retaining Strap — 1977 Wagoneer and Cherokee Models - Service Technical Letter - Refer to Service General.	7-04	77-122



## 1977

# HEADLINING-HARDTOP ENCLOSURE-EXTERIOR DECALS AND OVERLAYS

Subject (Problem and Application)	Bulletin Number	Page
Cracks or Tears in Door Exterior Sheetmetal — 1976 and 1977 CJ-7 Models With Hardtop Enclosure.	7-07	77-97
Whitco Top Loose at Front Former Caused by Insufficient Stitching at Front Edge of Top or Screws Loose in Front Former — 1976-1977 CJ Models Built Prior to VIN J7XXXXX035464.	7-04	77-101
Rear Headlining Sag — 1976 and 1977 Wagoneer and Cherokee Models.	7-03	77-103

## 1977 METAL REPAIR-PAINTING-WATER LEAKS/WIND NOISE

Subject (Problem and Application)	Bulletin Number	Page
Paint Information — All 1977 Jeep Vehicles.	TB-1	77-104
Golden Eagle Intermix Paint Formulas — 1977 CJ-7 and Truck Models With Golden Eagle Trim Package - Service Technical Letter - Refer to Service General.	7-07	77-119
Painted Bumpers — 1977 Cherokee and Truck Models - Service Technical Letter - Refer to Service General.	7-07	77-119
Touch-Up Spray Paint Identification — 1977 Models - Service Technical Letter - Refer to Service General.	7-02	77-124

## 1977 SERVICE GENERAL

Subject (Problem and Application)	Bulletin Number	Page
Replacement of Watershield Paper — 1977-79 Cherokee-Wagoneer-Truck Models.	9-10	77-109
Tire Size Capacity of Rear Swing-Out Spare Tire Carrier — 1976-79 CJ-5 and CJ-7 Models.	9-06	77-110
Compression Pressure Specification Update — 1977-79 Six and Eight-Cylinder Engines.	9-05	77-111
Automatic Transmission Clutch and Band Application Chart	9-03	77-112
Brake Master Cylinder Push Rod Retainer — 1977-78 CJ Models With Manual Disc Brakes.	8-05	77-113
Typographical Error — 1977 Technical Service Manual, Page 7-50 and 1978 Technical Service Manual, Page 2C-53.	8-02	77-115
Battery Post Contamination — All AMC Models.	8-02	77-115
Correction of Rear Wheel Cylinder Diameter — 1976 Technical Service Manual, Page 9-41 and 1977 Technical Service Manual, Page 9-47.	8-02	77-115
Replacement Parts for Off-Road Driving Lamp Kit — 1977 J-10 Truck Models With Golden Eagle Trim Package.	7-08	77-116
Automatic Transmission-to-Quadra Trac Transmission Installation — All Models With Automatic Transmission and Quadra-Trac.	7-08	77-116
Possible Gear Clash in Second and Third Gear - Caused by Worn Inserts in Synchronizer — 1977 CJ Models With T-150 Transmission - Built Between VIN J7XXXXX106233 and J7XXXXX109229.	7-08	77-116
Quadra-Trac Front Cover-to-Case Gasket — All Models With Quadra-Trac.	7-08	77-117
Vibrations Mechanical and Audible — All Jeep Vehicles.	7-07	77-118
Crankshaft Pilot Bushing — All Models.	7-07	77-118
Cruise Control Regulators — All 1977 Models Equipped With Cruise Command.	7-07	77-118
Front Exhaust Pipe-to-Exhaust Manifold Attaching Nuts — All 1977 Models.	7-07	77-119

## 1977 SERVICE GENERAL (Cont'd.)

Subject (Problem and Application)	Bulletin Number	Page
Painted Bumpers — 1977 Cherokee and Truck Models.	7-07	77-119
Golden Eagle Intermix Paint Formulas — 1977 CJ and Truck Models With Golden Eagle Trim Package.	7-07	77-119
Golden Eagle Trim Package — 1977 J-10 Truck Model.	7-06	77-120
Wheel Lug Studs Off Center in Rear Axle Shaft Flange — 1976 and 1977 Wagoneer and Cherokee Models.	7-05	77-121
Quadra-Trac Chain Tension Measurement.	7-05	77-121
Golden Eagle Intermix Paint Formula — 1977 CJ Models with Oak Leaf Brown, Code 7E.	7-05	77-121
Cooling System Thermostat Revision.	7-04	77-122
Rear Seat Retaining Strap — 1977 Wagoneer and Cherokee Models.	7-04	77-122
Relubable Propeller Shaft Slip Joints and Spiders — 1977 CJ Models.	7-04	77-122
Golden Eagle Trim Package — 1977 CJ-5 and CJ-7.	7-03	77-123
Improved Design Batteries — All 1977 Models.	7-02	77-124
Revised Procedure for Storage and Protection of New Vehicles.	7-02	77-124
Warn Lock-O-matic Hub Installation — 1977 Cherokee and J-10 Truck Models Built Between VINs J7XXXXX21438 and J7XXXXX031794.	7-02	77-124
Touch-up Spray Paint Identification.	7-02	77-124
Jeep Vehicles with Snow Plow/Winch Overheating at Highway Speeds.	7-02	77-125
Automatic Transmission - Manual Shaft Hex Nut — Early 1977 Models With Automatic Transmission.	7-01	77-126
Rear Axle Brake Application — Early Cherokee, Wagoneer and Truck Models.	7-01	77-126